NO. OF COFIES RECEIVED	• ,	Form C-103 Supersedes Old
DISTRIBUTION		C-102 and C-103
SANTA FE	NEW MEXICO OIL CONSERVATION COMMISSION	Effective 1-1-65
FILE	oci zu ii 16 W 252	
U.S.G.S.		5a. Indicate Type of Lease
LAND OFFICE		State Fee.
OPERATOR		5. State Oil & Gas Lease No.
SLINDS	RY NOTICES AND REPORTS ON WELLS	
(DO NOT USE THIS FORM FOR PRO USE **APPLICAT	POOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  ION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
1.		7. Unit Agreement Name
WELL WELL WELL 2. Name of Operator	OTHER-	O. Emp. on Louis Name
Sunray IX 011 Compar		N. M. State *AZ * State
3. Address of Operator	<u> </u>	9. Well No.
P. O. Bex 1116, Ross	rell. New Mexico	l n
4. Location of Well		10. Field and Pool, or Wildcat
UNIT LETTER G	1980 FEET FROM THE West LINE AND 660 FEET	Chaveroo San Andres
4.		
THE Horth LINE, SECTION	ON 34 TOWNSHIP 78 RANGE 33E	NMPM.
	15, Elevation (Show whether DF, RT, GR, etc.)	12. County
	11110 DF	Roosevelt
6. Check	Appropriate Box To Indicate Nature of Notice, Report of	or Other Data
PERFORM REMEDIAL WORK TEMPORARILY ABANDON	PLUG AND ABANDON REMEDIAL WORK COMMENCE DRILLING OPNS.	ALTERING CASING PLUG AND ABANDONMENT
PULL OR ALTER CASING	CHANGE PLANS CASING TEST AND CEMENT JOB	
	OTHER	
OTHER		
17. Describe Proposed or Completed Op	perations (Clearly state all pertinent details, and give pertinent dates, inc	luding estimated date of starting any proposed
work) SEE RULE 1103.	10.00 A W 10.30 AC	
r. shad rr. nors se	10:00 A.H. 10-19-65.	
2. Deill to 376: TD.	Ran 8 5/8", 2h#, J-55 cag to cag pt 370".	
2. 2222 50 310 120	man o y/o , ada, e-y/ eag so cag pe y/o-t	
3. Out w/210 sx reg	cat 2% CaCl2. Plug down & P.M. 10-19-65.	Ont Circ.
	_	
4. Drill 7 7/8" hole	to 3470'. Lest circ could not jet back	in hole below 1395'.
Wash hole to 1409	. Hole caved in and stuck I drill collar.	Ran Dialog freepoint
indicator. Back	off, leaving 1 drill collar in hole. Figh i	for drill collar 2 days
could not recover	<b>!•</b>	
- (mak - m		
5. A Pea hole as folio	ows: Placed hO ax cmt plug 1300-likh'. Place 5/8" esg w/10 ax cmt plug & install dry hole	sed 50 ax plug 103-208.
Lingsed top of o	>/o" esg w/10 ax cart plug & install dry hole	s marker. P&A complete
/ 5 P.M., 10-20-05.	Will skid rig 100' West for new location.	
8. I hereby certify that the information	above is true and complete to the best of my knowledge and belief.	
A > A	B.F. Brawley TITLE District Engineer	10 m 45
to B 3 03 Name	B.F. Brawley HITLE District Engineer	DATE 10-27-65
12 n- Ord	111 0	
Losles VI.	1 Come it	
BY	TITLE	DATE
'NS OF APPROVAL, IF ANY	:	