

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPL
(Other instructions
verse side)

E*
re

Form approved.

Bureau No. 42-81424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		5. LEASE INFORMATION AND SURVEY NO. LC-050142
2. NAME OF OPERATOR BIA Oil Producers		6. IF INDENTED, GROTTO OR TOWER NAME
3. ADDRESS OF OPERATOR 104 S. Pecos Midland Texas 79701		7. UNIT ADDRESS UNIT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 'N' - 660 FSL & 1980 FWL Section 30, T-8-S, R-36-E		8. FARM OR OTHER NAME Farm 001 Mid
14. PERMIT NO.		9. WELL NO. 1
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4130' G. L.		10. FIELD AND WELL, OR WHEN NOT, ON WHICH THE WELL IS LOCATED Vada
		11. SEC. T. R. OR MAP. OF THE LAND ON WHICH THE WELL IS LOCATED Sec. 30 T-8 R-36-E
		12. COUNTY, STATE, AND COUNTRY Roos New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	REPAIRING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☒	SHOOTING OR ACIDIZING ☐	REPAIRING TUBING ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	

(NOTE: Report results of multiple completion or recompletion operations on Wells Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including completion date, or date of proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for each marker and depth to bottom hole.)

Proposed Procedure:

Call USGS - Hobbs (505/393-3612) 24 hr. advance.

Hole to be filled w/mud laden fluid.

Lay down 2-7/8" tbg. & pkr.

Set CIBP @ 9700' w/3 sx cmt on top.

Cut & pull 5-1/2" csg. T/C @ 8070'.

Set 50 sx cmt @ stub.

Set 50 sx cmt @ 5472' Glorietta.

Set 50 sx cmt @ 4080' Base intermediate.

Cut & pull 8-5/8" csg.

Set 50 sx cmt on 8-5/8" stub.

Set 50 sx cmt @ 375' Base surface.

Set 10 sx cmt @ surface.

Install dry hole marker

18. I hereby certify that the foregoing is true and correct

SIGNED Janis Jones

TITLE Production Clerk

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

APPROVED
DEC 26 1972

*See Instructions on Reverse Side

