

Coquina Oil Corporation  
Pan Am State #1  
P&A Procedure

1. Spot 30 sx. cement in 5 1/2" casing at 6000'.
2. Cut 5 1/2" casing at approximately 5000'. Spot 30 sx. cement in 7 7/8" hole on top of 5 1/2" stub.
3. Pull & lay down 5 1/2" casing.
4. Spot 40 sx. cement across base of 8 5/8 casing from 4250 - 4150'.
5. Cut 8 5/8" casing and pull from approximately 800'.
6. Spot 40 sx. cement on top of 8 5/8" stub.
7. Spot 40 sx. cement across base of 13 3/8" casing from 425' - 350'.
8. Spot 10 sx. cement in top of 13 3/8" casing. Mud will be used to fill hole between plugs. *Mud should be approx 50 cP.*

Erect DHM.

We wish to have this well removed from the allowable schedule, effective February 12, 1972.