

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
OPERATOR'S COPY

OFFICE FOR MAPPING
OF COPIES REF
(Other Instructions
on reverse side)

Modified Form No.

NM60-3160-4

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	3. AREA CODE & PHONE NO. (505) 623-7210	8. FARM OR LEASE NAME Cone Federal
2. NAME OF OPERATOR Murphy Operating Corporation	9. WELL NO. 23	10. FIELD AND POOL, OR WILDCAT Chaveroo San Andres
3. ADDRESS OF OPERATOR P. O. Drawer 2648, Roswell, New Mexico 88202-2648	11. SEC., T., R., OR S.E. AND SURVEY OR AREA Sec. 27, T7S, R32E	12. COUNTY OR PARISH Roosevelt
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FSL & 660' FWL, Unit Ltr. M, Sec. 27, T7S, R32E	13. STATE New Mexico	
14. PERMIT NO.	15. ELEVATIONS (Show whether OP, RT, GR, etc.) 4479' GL, 4491' KB	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF	☐	WATER SHUT-OFF	☐
FRACURE TREAT	☐	FRACURE TREATMENT	☐
SHOOT OR ACIDIZE	☐	SHOOTING OR ACIDIZING	☐
REPAIR WELL	☐	(Other)	☐
(Other)	☐	(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	☒

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

8 5/8" casing set @ 1884', cemented w/400 sxs., circulated.
4 1/2" casing set @ 4430', cemented w/200 sxs.
Perforation 4200-4273'.
6-20-90 thru 6-27-90
Plugged and abandoned well in the following manner:

TIH and spot 20 sack cmt plug @ 4325'. Tag plug @ 4102'. Displace hole w/ gelled water (10ppg). TOH. Cut csg @ 2366'. TOH and lay down casing. TIH and spot 60 sack cmt plug @ 2431'. TIH and tag plug @ 2038'. Spot 120 sack cmt plug @ 1964'. TOH. TIH and tag plug @ 1715'. TOH to 60' and spot 15 sack cmt plug to surface. Install dry hole marker. Cut off and removed archors. Cleaned Location.

Note: All cement plugs were class C w/ 2% CaCl.



18. I hereby certify that the foregoing is true and correct

SIGNED John Brown TITLE Production Supervisor
(This space for Federal or State office use)

DATE 7/30/90

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:
Approved as to plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.

TITLE See attached info.

*See Instructions on Reverse Side

