


N. M. OIL CONS. COMMISSION  
P. O. BOX 1980  
HOBBS, NEW MEXICO 88240

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

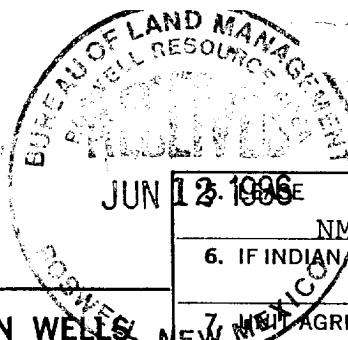

Form Approved.  
Budget Bureau No. 42-R1424

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other ☐  
2. NAME OF OPERATOR  
H. L. Brown, Jr.  
3. ADDRESS OF OPERATOR  
P.O. Box 2237 Midland, Texas 79702  
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 0-34-7S-37E  
AT TOP PROD. INTERVAL: 34-7S-37E  
AT TOTAL DEPTH: 34-7S-37E

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:	SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF <input type="checkbox"/>	<input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE <input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES <input type="checkbox"/>	<input type="checkbox"/>
ABANDON* <input type="checkbox"/>	<input checked="" type="checkbox"/>
(other) <input type="checkbox"/>	<input type="checkbox"/>

NM 17450	
6. IF INDIAN ALLOTTEE OR TRIBE NAME	
7. WELL AGREEMENT NAME	
8. FARM OR LEASE NAME Federal "K"	
9. WELL NO. 1	
10. FIELD OR WILDCAT NAME Bluitt (Wolfcamp) Gas	
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 34-7S-37E	
12. COUNTY OR PARISH	13. STATE
Roosevelt	New Mexico
14. API NO.	
15. ELEVATIONS (SHOW DF, KDB, AND WD) 4058' GL	

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations, and measured and true vertical depths for all markers and zones pertinent to this work.)\*

- 6-5-86 RU Brunson Unit, Kill well w/35 bbls 10# brine NU BOB. Toh  
W/tbg. Set CIBP (Plug #1) @ 8030'. Bailed 35' cmt on top of plug.
- 6-6-86 Set #2 Cmt plug 4640'-4540' (15 sxs).
- 6-7-86 Perf @3845' & sqz w/35 sxs from 3844'-3744' (plug #3) Perf @  
540' & sqz w/30 sxs from 540'-440'. (Plug #4)
- 6-8-86 SDFS.
- 6-9-86 Set surface plug & cut off wellhead. Set 10 sxs @ surface (plug #5)  
release rental equipment. Dug up anchors. Install marker post.
- 6-10-86 Well P&A'd. , waiting on ground to dry to clean location.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_

18. I hereby certify that the foregoing is true and correct

SIGNED John Mills TITLE Production Clerk DATE June 11, 1986

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

APPROVED  
PETER W. CHESTER  
JAN 30 1987  
BUREAU OF LAND MANAGEMENT  
ROSWELL RESOURCE AREA

RECEIVED  
FEB 9 1987  
OCD  
HOBBS OFFICE