

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fed <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <u>Dry Hole</u>		7. Unit Agreement Name
2. Name of Operator <u>Cities Service Oil and Gas Corporation</u>		8. Farm or Lease Name <u>Davis B</u>
3. Address of Operator <u>P.O. Box 1919 - Midland, Texas 79702</u>		9. Well No. <u>1</u>
4. Location of Well UNIT LETTER <u>A</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>990</u> FEET FROM THE <u>East</u> LINE, SECTION <u>3</u> TOWNSHIP <u>8S</u> RANGE <u>34E</u> NMPM.		10. Field and Pool, or Wildcat <u>Wildcat</u>
15. Elevation (Show whether DF, RT, GR, etc.) <u>4283' GR</u>		12. County <u>Roosevelt</u>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐
ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

T.D. 10,730' Lime & Dolomite. It is proposed to plug and abandon this well in the following manner:

1. RIH w/open ended DP and load hole with mud laden fluid. Spot a 50 sack cement @ approx. 10,730 - 10,580'. LDDP to 9895'.
2. Spot a 50 sack cement plug @ approx. 9895 - 9745'. LDDP to 7946'.
3. Spot a 50 sack cement plug @ approx. 7946 - 7796'. LDDP to 5097'.
4. Spot a 35 sack cement plug @ approx. 5097 - 4997'. LDDP to 3912'.
5. Spot a 35 sack cement plug @ approx. 3912 - 3812', half in and half out of the 8-5/8" casing shoe @ 3862'. LDDP to 1800'.
6. Spot a 35 sack cement plug @ approx. 1800 - 1700', across the top of the Rusler.
7. Spot a 10 sack cement surface plug @ approx. 35 - 0'. Install a 4" dry hole marker to designate a plugged and abandoned location.

This proposed plugging procedure was given verbal approval by Mr. Jerry Sexton w/NMOCD at Hobbs New Mexico.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Elmer Startz TITLE Reg. Opr. Mgr. - Prod. DATE 6-24-83

ORIGINAL SIGNED BY JERRY SEXTON
APPROVED BY DISTRICT I SUPERVISOR TITLE _____ DATE JUN 28 1983
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

JUN 27 1983

G.C.D.
HOBBS OFFICE