

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-041-20728
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG 5040
7. Lease Name or Unit Agreement Name Gramma ZM State
8. Well No. 1
9. Pool name or Wildcat Und. Chaveroo SA
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4315.1' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER ☐ P&A ☐

2. Name of Operator
YATES PETROLEUM CORPORATION

3. Address of Operator
105 South 4th St., Artesia, NM 88210

4. Well Location
Unit Letter E : 1650 Feet From The North Line and 330 Feet From The West Line
Section 16 Township 7S Range 34E NMPM Roosevelt County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned well as follows:

Set CIBP 4350' and cap with 5 sx cement. Cut 5-1/2" casing at 2500'. POH and laid down 2500' of casing.

Spot 50 sx cement plug at 2550'. WOC 4 hrs. Tag plug at 2371'.

Spot 50 sx cement plug at 1980'. WOC overnight. Tag shoe plug at 1795'.

Spot 10 sx cement plug 39' to surface. Circulated 10 sacks.. Dug out cellar. Cut off wellhead. Weld on dry hole marker. Cleaned location.

WELL PLUGGED AND ABANDONED - WORK COMPLETED 2-4-92.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE 2-5-92
TYPE OR PRINT NAME Juanita Goodlett TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY Billy Graham TITLE MAR 24 2000 DATE MAR 8

CONDITIONS OF APPROVAL, IF ANY: