

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OPEN
SUBMIT IN TF
(Other Instruct
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

3. LEASE DESIGNATION AND SERIAL NO.
NM044216

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Bluitt San Andres Unit

9. WELL NO.
13-6

10. FIELD AND POOL, OR WILDCAT
Bluitt San Andres Assoc.

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA
Sec.13, T8S, R37E

12. COUNTY OR PARISH
Roosevelt

13. STATE
NM

14. PERMIT NO.

15. ELEVATIONS (Show whether OF, TO, OR, etc.)
GR 4016.3

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐
☐

PCLL OR ALTER CASING

☐
☐
☐
☐
☐

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☒
☐
☐

FRACURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

☐
☐
☐
☐
☐

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

9-4-93 MIRU, unseat pump. POOH w/rods, pump. ND wellhead. Release TAC. POOH w/tbg, TAC SN, PS, BPMA. NU BOP. RIH w/CIBP, set @ 4610'. Perf 4" 1 JSPF @ 4504'-4577' (13 holes). Dump 2 sx cmt on CIBP. PU & RIH w/5-1/2" pkr, 2-3/8" SN, 142 jts 2-3/8" tbg hydrotesting to 5000 psi. RD hydrotester, close BOP. SI for press buildup

9-7-93 Press test pkr to 3500 psi, ok. Release press, op bypass, spot acid to pkr. Close bypass, acidize San Andres P1 zone w/546 gals 15% NeFe HCl, flush w/17 BFW, max 2700 psi, avg 1 BPM, min 850 psi, 42 gals/perf. Swab w/50' fluid rise every 20 mins rec 3/10th BF/hr w/50% oil cut, light to mod gas blow. SI for press buildup.

9-8-93 SITP 1350 psi. Blew down in 2 hrs. RIH w/2" swab. Tag FL @ 300' above SN. Release pkr. POOH w/pkr & tbg. RIH w/pkr, SN 2-3/8" tbg. Isolate perfs 4504'-4514' between tools. RU tbg swab, well kicked off & unloaded remaining load wtr. Well stabilized flowing 66 MCF w/no fluid, SI for pressure buildup.

18. I hereby certify that the foregoing is true and correct

SIGNED

Barrie Husband

TITLE

Administrative Assistant

Sept. 17, 1993

DATE

(This space for Federal or State office use)


APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED SEP 24 1993

*See Instructions on Reverse Side

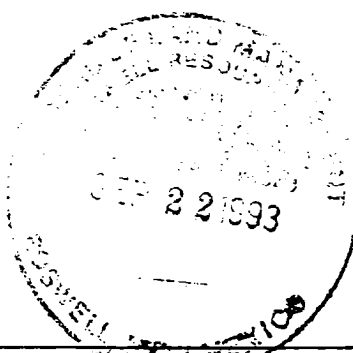

RECEIVED
SEP 20 8 50 AM '93

