

UNITED STATES N. M. OIL & GAS COMMISSION
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
HOBBS, NEW MEXICO 88240

Budget Bureau No. 1004-0-1-3
Expires August 31, 1985
5. LEASE DESIGNATION AND SERIAL

NM 69680

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Dry
2. NAME OF OPERATOR
H. L. Brown, Jr.
3. ADDRESS OF OPERATOR
Post Office Box 2237, Midland, Texas 79702
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
660' FNL & 660' FEL of Section 28, T 7S, R 37E, Unit A

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Federal "28" A Com

9. WELL NO.

1

10. FIELD AND POOL OR WILDCAT
North Bluit
(Siluro Devonian)

11. SEC., T., R., M., OR BLE. AND
SURVEY OR AREA

Sec 28, T 7S, R 37E

14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4062.6 GR

12. COUNTY OR PARISH 13. STATE

Roosevelt

NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

X

FRACTURE TREAT

MULTIPLE COMPLETE

X

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANE

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

PROCEDURES FOR PLUGGING AND ABANDONMENT

H. L. Brown, Jr. has been granted verbal approval from Pete Chester with the Roswell Area Office for the following plugging procedures.

1. Set CIBP @ 8050'. Dump 35 sacks cement on top. Circulate hole w/ 9 1/2 ppg mud.
2. Set CIBP @ 5635'. Dump 35 sacks cement on top.
3. Cut and pull 4 1/2" casing. (est 4000'-4500')
4. Set cement stub plug (140') 1/2 in & 1/2 out of casing stub. Must seal plug.
5. Set CIBP @ 3850'. Dump 35 sacks cement on top.
6. Set 100' cement plug from 475' to 575'.
7. Set 50' surface cement plug.
8. Cut off casing, set permanent marker.

Anticipated plugging date April 11, 1991.

18. I hereby certify that the foregoing is true and correct

SIGNED Mark A. Douch

TITLE Production Engineer

DATE April 11, 1991

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

APPROVED
PETE CHESTER

APR 17 1991

*See Instructions on Reverse Side