## State of New Mexico By, Minerals and Natural Resources Departm.

Form C-103 Revised 1-1-89

DISTRICT.1 P.O. Box 1980, Hobbs, NM 88240

P.O. Box 1980, Hobbi, NAY 88240 DISTRICT II

PULL OR ALTER CASING

OTHER:

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410 OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexic	a 87504-2088
---------------------	--------------

WELL API NO.	
30-041-20829	
5. Indicate Type of I case STATE K FEE	
STATE LE   FEE	!

State Oil & Gas Lease No.

	V-3514	
SUNDRY NOTICES AND REPORTS ON WELLS  ( DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  (FORM C-101) FOR SUCH PROPOSALS)	7. Lesse Name or Unit Agreement Name	
1. Type of Well:  Off. GAS WELL X WELL OTHER	Sawyer North Unit	
2. Name of Operator YATES PETROLEUM CORPORATION	8. Well No.	
3. Address of Operator	9. Pool name or Wildcat	
105 South Fourth Street - Artesia, NM 88210	Wildcat Permo Penn	
4. Well Location  Unit Letter 1 : 2310 Feet From The South Line and 700	Feet From The East Line	
	NMPM Roosevelt County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)		
11. Check Appropriate Box to Indicate Nature of Notice, Re	eport, or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DHILLING	OPNS. PLUG AND ABANDONMENT (X	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103.

2-13-96 - Moved in and rigged up pulling unit. Nippled up BOP. Till with 2-7/8" tubing and tagged top of cement plug and dress off at 5035'. Circulated wellbore clean with 2% KCL water. Swabbing open hole.

CASING TEST AND CEMENT JOB L

Testing open hole

2-14-96 - Swabbing. Prep to plug and abandon.

2-15-96 - Pulled tubing to 5025'. Loaded hole with 9.6# drilling mud. Set a 50 sack Class C 1% CaCl2 plug at 4210'. Pulled 8 stands. Reverse circulated tubing. WOC 2 hours. TIH and tag plug at 4060'. Set a 45 sack Class C 1% CaCl2 plug at 2420'. Set a 15 sacks Class C 1% CaCl2 plug from 30' to surface. Removed casing head. Cleaned location. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 2-14-96. NOTE: Notified OCD-Hobbs before commencing plugging operations.

<u>, , , , , , , , , , , , , , , , , , , </u>		
Thereby certify that the information above is the and complete to the best of tily knowledge and believe the significant with the significant time.	Production Clerk	2-19-96
TYPEOR PRINT HAME RUSty Klein		505-748-1471 ты енкиемо
(Thus space for State Use)	OIL & GAS diamen	