

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator Robinson Bros. Drilling Co. Inc.-Midland, Texas 79701		8. Farm or Lease Name Manry Elliott
3. Address of Operator % Hobbs Pipe & Supply Co.-P O Box 2010-Hobbs, New Mexico 88240		9. Well No. #1
4. Location of Well UNIT LETTER <u>C</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>22</u> TOWNSHIP <u>11-S</u> RANGE <u>31-E</u> NMPM.		10. Field and Pool, or Wildcat T V Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4470'		12. County Chaves

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK	<input type="checkbox"/>
TEMPORARILY ABANDON	<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>
OTHER	<input type="checkbox"/>

PLUG AND ABANDON	<input type="checkbox"/>
CHANGE PLANS	<input type="checkbox"/>
OTHER	<input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK	<input type="checkbox"/>	ALTERING CASING	<input type="checkbox"/>
COMMENCE DRILLING OPNS.	<input type="checkbox"/>	PLUG AND ABANDONMENT	<input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOBS	<input type="checkbox"/>	OTHER	<input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Well P & A as follows:

1. Tubing plug set in Baker Model "D" Packer @10729'
2. Cut tubing, circ hole with mud, spot 10sx cement plug on top of packer.
3. Cut & pulled 5976' of 5 1/2" casing
4. Spot 35sx Cement plug at 5 1/2" casing stub at 5976'
5. Spot 30sx Cement plug at 4890' (Glorieta)
6. Spot 45sx Cement plug at 9 5/8" casing shoe @ 3613'
7. Spot 45sx Cement plug at 1560' (top of salt)
8. Set 10sx surface plug with marker

P & A 2 FEB 76

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED R M Williams

TITLE Agent, Hobbs Pipe & Supply

DATE 6 FEB 76

APPROVED BY John W. Ramsey

TITLE Geologist

DATE AUG 18 1977

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

FEB 9 1976

OIL CONSERVATION COMM.  
HOUSTON, TEX.