

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL <input type="checkbox"/> GAS <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Great Western Drilling Company	8. Farm or Lease Name
3. Address of Operator	9. Well No.
4. Location of Well UNIT LETTER _____ FEET FROM THE _____ LINE AND _____ FEET FROM THE _____ LINE, SECTION _____ TOWNSHIP _____ RANGE _____ NMPM.	10. Field and Pool, or Wildcat
15. Elevation (Show whether DF, RT, GR, etc.)	12. County

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3. Pull tbg., rig up elevators, spider, slips and tongs for 5½" casing. Find free point and shoot casing in collar - pull & lay down casing. Rerun tbg to 50' into the 5½" csg stub cut off - spot 25 Sx plug (108' plug), 50' in 5½" csg stub and 58' in the 7 7/8" hole - pull tbg above plug - WOC - tag top of plug - if plug is satisfactory - pull & lay down tbg to 50' below the 8 5/8" OD csg shoe.
4. With tbg opened ended 50' below the 8 5/8" csg shoe, spot 35 Sx plug (106' plug), 50' in 7 7/8" hole & 56' in the 8 5/8" csg. (353' - 247'). Pull tbg above plug - WOC - tag plug - if satisfactory, set 10 Sx plug @ surface.
5. Install steel marker, 4" diameter pipe set in concrete, extending 4' above GL. Stamp on marker or weld - well name and number, location, (Unit letter, section, township and range) as listed below:
COMPANY: Great Western Drilling Company
LEASE: Rock Queen Unit Tr. 13
WELL NO: 36-8
LOC: 660' FEL, 1,980' FNL, Sec. 36, T-13-S, R-31-E, Unit Letter H, Chaves County, New Mexico.
6. Clean up location for inspection.
Estimated Tops: T-Anhydrite 1,440', T-Salt 1,560', B-Salt 2,190', T-Yates 2,280', T-7 Rivers 2,420' & T-Queen 3,061'.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED _____ TITLE _____ DATE _____

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
NOV 18 1982
REC'D.
HOLDS OFFICE