NO. OF COPIES RECEIVED		5.0.00
DISTRIBUTION	 	Form C-103 Supersedes Old
SANTAFE	NEW MEXICO OIL CONSERVATION COM	C-102 and C-103
FILE		MISSION Effective 1-1-65
U.S.G.S.		5a. Indicate Type of Lease
LAND OFFICE		State X Fee
OPERATOR		5. State Oil & Gas Lease No.
(DO NOT USE THIS FORM FOR	NDRY NOTICES AND REPORTS ON WELLS R PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT LICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	RESERVOIR.
1.	FORM COLOT POR SUCH PROPUSALS.)	7. Unit Agreement Name
OIL GAS WELL 2. Name of Operator	OTHER- Water Injection	Eastcap Queen Pool Unit
		5.1 drill of Lease Name
AGUA, INC. 3. Address of Operator		9. Well No.
	Wall Waster 00010	2
Box #198, Artesia,	New Mexico 88210	10. Field and Pool, or Wildcat
	1450	
UNIT LETTER	1650 FEET FROM THE South LINE AND 3	30 FEET FROM CAPTOCK QUEEN
THE West	22 14 Court 2	
THE WEST LINE, S	ECTION 23 TOWNSHIP 14 South RANGE 3	1 East NMPM.
	15. Elevation (Show whether DF, RT, GR, etc.)	12. County
		Chaves
16.	ck Appropriate Box To Indicate Nature of Notic	***************************************
	F INTENTION TO:	SUBSEQUENT REPORT OF:
7,01102.0	THE TOWN TO.	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON X REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	COMMENCE DRILL	
PULL OR ALTER CASING	CHANGE PLANS CASING TEST AND	
	OTHER	
OTHER		
17. Describe Proposed or Complete work) SEE RULE 1103.	ed Operations (Clearly state all pertinent details, and give perti	nent dates, including estimated date of starting any proposed
•	shut-in water injection well. The fol-	lowing plugging pages and and a
by Mr. Ramey by phone	e on Dec. 13, 1973. It is proposed to	proceed with plugging and abandonin
as follows:	m / 4 m // 2444	
	Total Depth - 3136'	
	Surface Casing - 8-5/8" 24# at 196	5' w/125 sx.
	Prod. Casing - 4½" 9.5# at 3136'	W/150 sx.
	Perforations - 3098-3104'.	THE COMMISSION MUST LE MOTIFIED 24
	Tubing - 3076' w/tension packer.	HOURS PRIOR TO THE RECINNING OF
	Top of Salt - 1460'.	PLUGGING OPERATIONS FOR THE C-103
	Diameter D	TO BE APPROVED.
1 Drocood	Plugging Program	TO THE MOVED.
	with either Option A or B.	
Option	A - Set bridge plug above perforations	s and cap with 35' cement.
2 Cu+ ait	B - Place 100' cement plug above performance of Place 100' cement plug above performance and plug abov	orations.
2. Cut oil casing off. Place 100' cement plug at top of stub. If stub is below		
top of salt, place 100' cement plug at top of salt. 3. Place 100' cement plug to straddle bottom of surface casing.		
A Can wit	h 10 sacks cement.	surface casing.
Mud hole during niver	ing procedure. Notify Oil Commit	
were note couting bings	ing procedure. Notify Oil Commission	at start of operations.

TITLE Consulting Engineer.

DATE Dec. 13, 1973

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Jee D. Ramey Dest. I. Supv.