

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
<b>E-9089</b>

## SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator <b>EXXON CORPORATION</b>	8. Farm or Lease Name <b>NEW MEXICO STATE BW</b>
3. Address of Operator <b>P.O. BOX 1600, MIDLAND, TEXAS 79701</b>	9. Well No. <b>6</b>
4. Location of Well UNIT LETTER <b>J</b> <b>1985</b> FEET FROM THE <b>SOUTH</b> LINE AND <b>1997</b> FEET FROM THE <b>EAST</b> LINE, SECTION <b>21</b> TOWNSHIP <b>8-S</b> RANGE <b>33-E</b> NMPM.	10. Field and Pool, or Wildcat <b>TOBAC PENNSYLVANIAN</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>4383 DF</b>	12. County <b>CHAVES</b>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

**10-10-73 LOADED 4 1/2" CSG W/50 BBLs WTR, PRESS TO 1000 PSI, WOULD NOT TAKE WTR. PICKED UP ON TBC, UNABLE TO PULL, RAN EXTRA JOINT IN HOLE. INSTALLED BOP & BACKED RODS OFF. 10-11-73 ARGE POINTED TBC & CUT OFF @ 8944. 10-12-73 RAN CAUSE RING TO 4824, RAN BRIDGE PLUG ON WIRELINE TO 4854, RAN TBC TO 8900 & CIRC OUT W/70 BBLs. OIL. 10-13-73 CIRC. OUT WTR. SPOT 25 SX CMT PLUG AT 8900. 10-15-73 REMOVE SLIPS REINSTALL BOP, RAN FREE POINT, WOULD NOT GO BELOW 4824. SHOT CSG AT 4790 PIPE JARRED BUT WOULD NOT MOVE. 10-16-73 RAN SHOT IN HOLE AND PULLED LOOSE AT 3410. RAN SHOT & CUT PIPE FREE AT 3637. 10-17-73 RAN TBC TO 3641 CIRC. W/MUD, SPOT 50 SY CMT. PLUG. 10-18-73 TAG CMT. PLUG AT 3530, STRIP WELL HEAD & BOP, CUT 7 5/8 CSG BELOW SLIPS & CUT OFF SURF HEAD. WELD LIFT SUB TO 7 5/8 CSG. & INSTALL HYD CSG JACKS. CSG INDICATED STUCK AT 750', SHOT 7 5/8 CSG AT 742' & PULLED TO FREE. 10-19-73 SPOT PLUGS AT 747 & 455 EACH 60 SXS. PUT 10 SX PLUG IN SURF & INSTALL ORY HOLE MARKER.**

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED **J. A. Stwall** TITLE **UNIT HEAD** DATE **10-18-74**

APPROVED BY **Nathan E. Kegg** TITLE  DATE

CONDITIONS OF APPROVAL, IF ANY: