

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U. S. S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
 P. O. BOX 2088
 SANTA FE, NEW MEXICO 87501

Form C-101
 Revised 10-1-73

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM AND PROPOSALS TO DRILL OR TO REPER OR PLUG WELLS TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT TO DRILL C-101 FOR SUCH PROPOSALS.

50. Indicate Type of Lease State <input checked="" type="checkbox"/> New <input type="checkbox"/>
51. State Oil & Gas Lease No. K 745
7. Unit Agreement Date --
8. Form or Lease Name Sunray State #
9. Well No. #1
10. Field and Pool, or Wellcut Siete San Andrews
12. County Chavez

1. Name of Operator
 H. L. Brown, Jr.
 Address of Operator
 Box 2237 Midland, Texas 79702

2. Location of Well
 UNIT LETTER E 660 FEET FROM THE W LINE AND 1980 FEET FROM
 THE N LINE, SECTION 16 TOWNSHIP 8S RANGE 31E N.M.P.M.

15. Elevation (Show whether DF, RF, GR, etc.)
 4220 GR

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK

TEMPORARILY ABANDON

PULL OR ALTER CASING

OTHER

PLUG AND ABANDON

CHANGE PLANS

SUBSEQUENT REPORT OF:

REMEDIAL WORK

COMMENCE DRILLING OPNS.

CASING TEST AND CEMENT JOBS

OTHER

ALTERING CASING

PLUG AND ABANDONMENT

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Move in, rig up plugging equipment. Dig pit.
2. POOH and lay down rods.
3. ND Wellhead and NU BOP. POOH with tubing.
4. Set 4½" CIRP at 3675' and cap with 35' of cement.
5. RIH with tubing to 3600'. Circulate hole with 10# brine consisting of 25# Salt gel per bbl.
6. PUH with tubing to 3050' and spot a 25 sack plug.
7. POOH with tubing. ND wellhead and weld on 4½" pull nipple. Remove casing slips, work pipe and figure stretch. Cut casing at freepoint (1300'±).
8. Lay down 4½" casing.
9. RIH with tubing to 50' inside casing stub. Spot a 35 sack plug. WOC and tag.
10. POH with tubing to 1387' and spot a 35 sack plug.
11. PUH with tubing to 366' and spot a 45 sack plug. WOC and tag.
12. POOH with tubing, cut off well head and spot a 10 sack surfact plug. Install dry hole marker.
13. Rig down plugging equipment. Cover pit and cellar and move off.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 PERMIT APPROVED.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

APPROVED Mike Juarez TITLE Engineer DATE 6-24-88

ORIGINAL

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

SECRET

JUN

15