

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
L-414	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator BISON PETROLEUM CORPORATION	8. Farm or Lease Name State 16
3. Address of Operator 203 W. 8th Suite 510 Amarillo, Texas 79101	9. Well No. 2
4. Location of Well UNIT LETTER G, 2310 FEET FROM THE North LINE AND 2310 FEET FROM THE East LINE, SECTION 16 TOWNSHIP 14S RANGE 30E NMPM.	10. Field and Pool, or Wildcat Vest Ranch Queen
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Chaves

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8-17-83 MI & RU PBCP Services, Inc. Pull rods and pump. Run back open ended and tag bottom @ 2100'. Pull to 2096'. Load hole. Spot w/15 sx. Class A cmt. @ 2096' in 4 1/2". POOH w/tbg. Plug: 1940-2096'.

8-18-83 Run tbg. and tag TOC @ 1940'. Load hole w/10 lb. MLF. POOH w/tbg. Pull & LD 20 jts. (recovered 807' 4 1/2"). Run tbg. to 840'. Spot 40 sx. Class A cmt. WOC 2 hrs. Tag TOC @ 694'. Plug: 694-840'. Pull to 107'. Pump 60 sx Class A cmt. to surface. Plug 107' to surface. Left 1383' 4 1/2" 9 1/2# csg. in hole.

Tack on 4' descriptive marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Melizabeth Jones TITLE Administrative Secretary DATE 9-12-83

APPROVED BY AG Patterson TITLE OIL & GAS INSPECTOR DATE MAR 2 1984

CONDITIONS OF APPROVAL, IF ANY: