N. M. GIL CONS. COMMISSION P. O. BOX 1980 HOBBS, NEW MEXICO 88240

Form 3160-5

## **UNITED STATES**

FORM APPROVED

	ITMENT OF THE INTERIOR U OF LAND AMANGEMENT	Budget Bureau No. 1004-0135		
BUREA	Expires: March 31, 1993			
	5. Lease Designation and Serial No.			
SUNDRY NO	NM-15678			
	drill or to deepen or reentry to a different reservoir.	6. If Indian, Allottee or Tribe Name		
Use 'APPLICATIO	N FOR PERMIT— for such proposals			
	7. If Unit or CA, Agreement Designation			
1. Type of Well Oil Gas				
Well Well X Other SWD	8. Well Name and No.			
2. Name of Operator	Ingram Federal #2			
MURPHY OPE	9. API Well No.			
3. Address and Telephone No. P.O. Box 2545	30-005-20488			
Roswell, New	10. Field and Pool, or Exploratory Area Tom Tom San Andres			
4. Location of Well (Footage, Sec., T., R., M., or Surve				
1980' FSL & 6	11. County or Parish, State			
Section 5–8S	Chaves County, New Mexico			
12. CHECK APPROPRIATE BOX	((s) TO INDICATE NATURE OF NOTICE, REPORT,	OR OTHER DATA		
TYPE OF SUBMISSION	TYPE OF ACTION			
X Notice of Intent	X Abandonment	Change of Plans		
	Recompletion	New Construction		
Subsequent Report	Plugging Back	Non-Routine Fracturing		
<u> </u>	Casing Repair	Water Shut - Off		
Final Abandonment Notice	Altering Casing	Conversion to Injection		
	OTHER	Dispose Water		
		(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)		
13. Describe Proposed of Completed Operations (Cleadirectionally drilled, give subsurface locations and n	arly state all pertinent details, and give pertinent dates, including estimated neasured and true vertical depths for all markers and zones pertinent to th	1 4-46-4 1 1 70 111		

Murphy Operating Corporation requests approval to plug and abandoned well as follows:

- 1. Set CIBP at 3830'. Spot 35' of cement on top with dump bailer.
- 2. Circulate hole with 9# per gallon mud. Determine free point.
- 3. Cut casing at approximately 1200'.
- 4. Spot 150' plug one-half in and one-half out of casing stub with 40 sacks Class "C" cement. Lay plug-
- 5. Spot 150' plug at 490' one-half in and one-half out of surface casing shoe with 40 sacks Class "C" cement. Tag play.
- 6. Spot 50' plug at surface with 15 sacks Class "C" cement.
- 7. Install Dry Hole Marker.
- 8. MO equipment. Restore location.

· · · · · · · · · · · · · · · · · · ·		<u>.                                    </u>			
4. I hereby certify that the foregoing is true and correct Signed	Title Produ	ction Records Manager	Date	8/3/95	_
(This space for Federal or State office use)			AP	PROVER	==
Approved by	Title		Date	PROVED W. CHESTER	
Conditions of approval, if any:					
			AUG	1 1 1995	
Title 18 U.S.C. Section 1001, makes it a crime for any person kr statements or representations as to any matter within its jurisdic	owingly and willfully to tion.	make to any department or agency	Bothe United States	any false, fictitious or fraudule	nt
•	See Instruction or	Revers Side	ROSWELL RE	SOURCE SOURCE \$3 60-5.	WK1