

**SUMERLIN NO. 1**  
**Tobac Field**  
**Chaves County, New Mexico**

**Procedure to Plug and Abandon**

---

1. MIRU Dawson PS. Hold safety meeting. POOH with rods and pump. Lay all down.
2. ND WH. NU BOP. Back off or cut 2 7/8" casing @  $\pm 7,300'$ , POOH and LD.
3. RU BJ Services. Pump cement plugs as follows:

<u>Plug No.</u>	<u>Btm. of Plug</u>	<u>Top of Plug</u>	<u>No. Sacks Cmt.</u>
1	9,002'	7,200'	36
2	6,500'	6,356'	9
3	5,000'	2,960'	130
4	2,500'	1,843'	196
5	10'	0'	3

4. Set marker in cement to give location of well. RD MO.
5. Change status to P & A.

THE COMPLETION MUST BE NOTED 24  
HOURS AFTER THE RECEIPT OF  
A RECORD OF DECISIONS FOR THE PLUG  
AND ABANDON