Form 3:60-5 (Ni vember 1983) (T <del>ometry</del> '9-331) [	UNITO STATES DEPARTMEN OF THE INTER BUREAU OF LAND MANAGEMEN	N. M. All CONS. Contraction POR BOX LABOUTION TO TOBBS, NEW MEXICO 88	5. LEASE DESIGNATION A	31, 1985
SUND	RY NOTICES AND REPORTS (		6 IF INDIAN, ALLOTTEE	OR TRIBE NAME
(Do not use this for U	m for proposals to drill or to deepen or plug l se "APPLICATION FOR PERMIT_" for such p	back to a different reservoir. roposals.)		
1. OIL (77) GAS (	7. UNIT AGREEMENT NAME			
WELL A WELL OTHER  2. NAME OF OPERATOR			8. FARM OR LEASE NAME	
Western Reserve	Western Reserve	Western Reserves "34" Federa 9. WBLL NO.		
P.O. Box 993, M	2			
<ol> <li>LOCATION OF WELL (Report location clearly and in accordance with any State requirements.<sup>4</sup> See also space 17 below.) At surface</li> </ol>			10. FIELD AND POOL, OR	
Unit A, 330' FN	Tom-Tom (San Andres) 11. SRC, T. B., M., OR BLE. AND SUBVEY OR ARYA			
14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, CR, etc.)			Sec. 34, T7S-R31E 12. COUNTY OF PARISH 13. STATE	
	DF 4351		Chaves	NM
16.	Check Appropriate Box To Indicate N	lature of Notice, Report, or	Other Data	
NOT	CE OF INTENTION TO :	8UB81	QUENT REPORT OF :	
TEST WATER SHUT-OFF	PULL OR ALTER CASING	WATER SHUT-OFF	BEPAIRING WI	
FRACTUBE TREAT	MULTIPLE COMPLETE	FRACTUBE TREATMENT	ALTEBING CAS	1
SHOOT OR ACIDIZE Repair well	ABANDON*	SHOOTING OR ACIDIZING	ABANDON MENT	
(Other) 7. DESCRIBE PROPOSED OR CU proposed work. If we nent to this work.)*	MPLETED OPERATIONS (Clearly state all pertinen Il is directionally drilled, give subsurface locat	t details, and give pertinent dates	is of multiple completion or pletion Report and Log form a, including estimated date cal depths for all markers	of starting any
				7
				-
8. I hereby certify that the	foregoing is true and correct			
SIGNED JOLT	Janica TITLE Agen	t	DATE2-21-	-89
(This spice for Federal of	State office use)	P		
APPROVED BY CONDITIONS OF APPR	DVAL, IF ANY:		PETER W. CHE	D
	*See Instructions	on Reverse Side	MAR 1 19	
Title 18 U.S.C. Section 10 United States any faise. 5	001, makes it a crime for any person know actitious or fraudulent statements or repr	ungly and willfully to make to esentations as to any matter w	BUREAU OF LAND MAI an ROSWELNE RESOURC	NAGEMENT ÆABFAhe

UN 22 RM CACO HORE SICE

RELEVET

r

ł

-



## Natural Resources Engineering

## PLUGGING PROPOSAL

OPERATOR: WESTERN RESERVES OIL CO. INC.WELL: WESTERN RESERVES "34" FEDERAL #2FIELD: TOM-TOM (SAN ANDRES)LOCATION: SECTION 34, T7S-R31ECOUNTY: CHAVESSTATE: NEW MEXICOTOTAL DEPTH: 4150'DATE: FEBRUARY 21, 1989REV: 0

1. Rig up well plugging unit, pull and lay down rods and pump.

- 2. Pull 2 3/8" tubing and stand in derrick.
- 3. Rig up wireline and run in hole with gauge ring to 3960't.
- 4. Set CIBP on wireline @ 3900't, cap w/2 a cement, { 35' w/ dump back
- 5. Rig up and take stretch on 4 1/2" 9.5# K-55 ST&C csg. Should be free about 2800'.
- 6. Shot off csg and pull same. Run back to 3900' with tubing, displace hole with Salt Gel Mud.
- 7. Set a 35 sx plug across 4 1/2" csg stub @ 2800'. Tag this plug.
- 8. Set 55 sx plug @ 1600-1700' across 8 5/8" csg shoe @ 1657'. Tag This plug.
- 9. Set 10 sx plug @ surface. Remove wellhead. Weld cap on 8 5/8" csg, install dry hole marker. Rig down plugging unit, cut off anchors, clean location and release unit.
- 10. Remove all equipment and clean location, prepare for inspection.

WP/plugwroc.txt