

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240DISTRICT II
P.O. Drawer DD, Artesia, NM 88210DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-005-20808
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	
Sanders	
8. Well No.	1
9. Pool name or Wildcat	Lightcap (Montoya)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☒ OTHER	
2. Name of Operator Graham Royalty, Ltd.	
3. Address of Operator 5429 LBJ Fwy, Suite 550 Dallas, TX 75240	
4. Well Location Unit Letter <u>E</u> : <u>1900</u> Feet From The <u>North</u> Line and <u>660</u> Feet From The <u>West</u> Line Section <u>8</u> Township <u>8S</u> Range <u>30E</u> NMPM Chaves County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4047' KB 4035' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

13-3/8" 48# CSA 453'. Cmtd w/ 475 sx. TOC @ surface.

8-5/8" 24# CSA 2465'. Cmtd w/ 975 sx.

4 1/2" 10.5 & 11.6# CSA 7951'. Cmtd w/ 800 sx. TOC @ 6100' per CBL.

Montoya perfs - 7903-7911'. 4 1/2" CIBP @ 7850' capped w/ 35' cmt plug. (PBSD-7815')

Penn Lime perfs - 7106-7109', 7112-7126'.

1. MIRU workover unit. POOH w/ 2-3/8" tbg & pkr.

2. Set 4 1/2" CIBP @ 7050'. Cap w/ 35' cmt plug. Displace hole w/ 10 ppg mud-laden fluid.

3. Cut 4 1/2" csg @ 6100'. TOOH & LD csg.

4. Spot 50 sx cmt plug from 6200'-6000'. Spot 40 sx cmt plug from 2515-2415'.
Spot 40 sx cmt plug from 503-403'. Spot 10 sx surface plug.

5. Cut off wellhead. Install dry hole marker. RD pulling unit. Clean location.

100' plug at 3600

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE



TITLE

District Engineer

DATE

1-29-90

TYPE OR PRINT NAME

Jon Hale

TELEPHONE NO. 214/991-3344

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY

TITLE

DATE

FEB 05 1990

CONDITIONS OF APPROVAL, IF ANY:

THIS DOCUMENT IS THE PROPERTY OF THE NEW MEXICO
DEPARTMENT OF ENERGY, MINERALS AND NATURAL RESOURCES
AND IS LOANED TO YOU BY THE BUREAU OF OIL AND GAS
CONSERVATION. IT IS TO BE RETURNED TO THE BUREAU OF OIL AND GAS
CONSERVATION WHEN NO LONGER NEEDED.