

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
HOBBS, NEW MEXICO 88240

Form approved.  
Budget Bureau No. 1004-0135  
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

88240 NM 046153A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Western Reserves Oil Co.	8. FARM OR LEASE NAME Western Reserves "34" Federal
3. ADDRESS OF OPERATOR P.O. Box 993, Midland, Texas 79702	9. WELL NO. 7
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit L, 1980' FSL & 660' FWL	10. FIELD AND POOL, OR WILDCAT Tom-Tom (San Andres)
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 34, T7S-R31E
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4305 GR	12. COUNTY OR PARISH Chaves
	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) \*

SEE ATTACHED PLUGGING PROPOSAL

18. I hereby certify that the foregoing is true and correct

SIGNED Joe T. James

TITLE Agent

DATE 2-21-89

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

TITLE \_\_\_\_\_

APPROVED  
PETER D. CHESTER

MAR 2 1989

BUREAU OF LAND MANAGEMENT  
ROSWELL RESOURCE AREA

\*See Instructions on Reverse Side

RECEIVED

JUN 28 1999

OCO  
HOBBS OFFICE



# Natural Resources Engineering

## PLUGGING PROPOSAL

OPERATOR: WESTERN RESERVES OIL CO. INC.

WELL: WESTERN RESERVES "34" FEDERAL #7

FIELD: TOM-TOM (SAN ANDRES)

LOCATION: SECTION 34, T7S-R31E

COUNTY: CHAVES

STATE: NEW MEXICO

TOTAL DEPTH: 3970'

DATE: FEBRUARY 21, 1989

REV: 0

\*\*\*\*\*

1. Move in well service unit and rig up.
2. Pull rods and lay down. Pull tubing and stand back in derrick.
3. Rig up wireline truck, run gauge ring to 3900'±. Run CIBP and set @ 3875' and cap with ~~2~~ <sup>35</sup> sx cement. *35' cmt. w/ dump trailer or 50' if through tubing.*
4. Tie on to 4 1/2" 10.5# J-55 ST&C csg. Take stretch and shoot off at free point. (Est @ 2700') Pull and lay down 4 1/2".
5. Run back in hole with tubing to 3875'±, displace hole with Salt Gel Mud.
6. Place a 35 sx plug @ @ 4 1/2" csg stub, 50' in and 50' out. Tag this plug.
7. Place <sup>43</sup>~~35~~ sx plug across 8 5/8" csg shoe @ 1520'. *Tag plug*
8. Place <sup>18</sup>~~10~~ sx plug @ surface, take off wellhead, weld cap on 8 5/8" csg. Install dry hole marker.
9. Rig down well service unit, cut off anchors, clean location and release rig.
10. Remove all equipment from location, clean and prep for inspection.

WP/plugwroc.txt

