

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-005-20909
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG 1520
7. Lease Name or Unit Agreement Name Cone State
8. Well No. 2
9. Pool name or Wildcat Tom Tom SA
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4373.4' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER P&A ☐

2. Name of Operator
YATES PETROLEUM CORPORATION (505) 748-1471

3. Address of Operator
105 South 4th St., Artesia, New Mexico 88210

4. Well Location
Unit Letter I : 1980 Feet From The South Line and 660 Feet From The East Line
Section 2 Township 8S Range 31E NMPM Chaves County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4373.4' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned well as follows: Notified NMOCD before starting operations so they can witness job.
1-16-92. RUPU. Lay down 164 rods. ND wellhead. PU tubing. Tubing parted at wellhead slip. RU fishing tools. Got tubing. POH with 130 jts tubing. Set CIBP at 3910' and spot 35' cement on top of plug. Mix mud. Circulate hole with mud. POH with tubing. ND BOP and casing head. Cut 4 1/2" casing at 2150'. POH and lay down 52 joints 4 1/2" casing. RIH with tubing to 2200'. Spot 50 sx cement plug. WOC. Tag stub plug at 1970'. POH with tubing to 1720'. Spot 90 sx cement plug. Pull 10 stands tubing. WOC 3 hrs. RIH with tubing. Tag plug at 1490'. POH with tubing to 400'. Spot 30 sx cement plug. POH to 37'. Circulate cement to surface. Cut off wellhead. Install dry hole marker.

Plugging completed 1-22-92.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE 2-3-92
TYPE OR PRINT NAME Juanita Goodlett TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE OCT 05 1993
CONDITIONS OF APPROVAL, IF ANY: