

Form C-103

Detailed Account of Work done

Caprock Queen Unit #1- Well No. 6-3

5-2-60 Moved in equipment of A. N. Russell and Sons. Pulled rods and tubing out of well.

5-3-60 Cleaning out cavings with sand pump from 3030' to 3041'

5-4-60 Cleaning out cavings and mud from 3041' to 3050'.

5-5-60 Bailed hole clean. Dumped Pea gravel and $1\frac{1}{2}$ sacks Calseal. No. fill.

5-6-60 Dumped $2\frac{1}{2}$ sacks Calseal. Plug at 3029'. Filled hole with water. Plug held OK.

5-9-60 Set 126.53' of 4" liner. Cemented with 125 sacks cement with 2% calcium chloride.

5-10-60 Checked cement job. Held OK.

5-11-60 Drilling cement in liner from 3007' to 3020'.

5-12-60 Drilling cement from 3020' to 3027'. Drilling on shoe.

5-13-60 Finished drilling shoe. Drilling Calseal and pea gravel to 3030'.

5-14-60 Cleaned out pea gravel to 3044'. Bailed and cleaned hole.

5-15-60 Ran tubing and rods. Put well back on pump. Moved machine off location.