

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. <b>B-9505</b>	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name -
2. Name of Operator <b>Texaco Inc.</b>		8. Farm or Lease Name <b>N.M. "AT" State</b>
3. Address of Operator <b>P.O. Box 728, Hobbs, New Mexico 88240</b>		9. Well No. <b>5</b>
4. Location of Well UNIT LETTER <b>M</b> <b>660</b> FEET FROM THE <b>West</b> LINE AND <b>660</b> FEET FROM THE <b>South</b> LINE, SECTION <b>10</b> TOWNSHIP <b>14-S</b> RANGE <b>33-E</b> NMPM.		10. Field and Pool, or Wildcat <b>Saunders Perms Penn</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>4227' (DF)</b>		12. County <b>Lea</b>

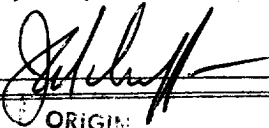
16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOBS <input type="checkbox"/>	
OTHER <b>Clean out &amp; addl perms in Penn zone</b> <input checked="" type="checkbox"/>		OTHER <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up. Pull rods & pump. Install BOP. Pull tubing.
2. Fish junk in hole & clean out 9932' (PBTD).
3. Set RBP @ 9928'. Acidize perms 9898-9923' w/3500 gals 15% NEFE HCl acid in 2 stages using 150# rock salt between stages. Flush w/2400 gals. 2% KCl water.
4. Perforate 2-7/8" casing w/2 JSPF @ 9791', 94', 97', 9849', 52', 59', & 9863'.
5. Reset RBP @ 9870'. Acidize perms 9791'-9863' w/4000 gals 15% NEFE HCL acid in 4 stages using 450# rock salt between stages. Flush w/2380 gals 2% KCl water. Pull RBP.
6. Install pumping equipment. Test & return to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE <b>Asst. Dist. Mgr.</b>	DATE <b>8-9-82</b>
ORIGIN <b>JERRY</b>	TITLE	DATE
APPROVED BY <b>JERRY</b>	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		

**AUG 11 1982**

RECEIVED  
AUG 10 1982  
O.C.D.  
HOBBS OFFICE