



STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT
OIL CONSERVATION DIVISION

BRUCE KING
GOVERNOR
LARRY KEHOE
SECRETARY

POST OFFICE BOX 2088
STATE LAND OFFICE BUILDING
SANTA FE, NEW MEXICO 87501
(505) 827-2434

PLUGGING PROCEDURE

CORINNE GRACE
Ranger Well No. 1-SWD
Unit H, 1980/N & 660/E, Section 15, T-12-S, R-34-E

Contractors will furnish tubing, mud, water and cement, and will construct pits as necessary. All plugs will be set through tubing.

1. Displace hole to mud -- all fluid to be displaced into pit and properly disposed of.
2. Set CIBP at 2770⁺ and dump 35' of cement over top of CIBP.
3. Set 100' plug inside of 8 5/8" casing at approximately 2100' (Top of Anhydrite)
4. Set 10 sack cap with regulation marker as prescribed by OCD Rules and Regulations.
5. Proper clean up will be made and all salvaged equipment will be moved to a place to be designated.
6. Return surface to as near normal conditions as possible.
7. All work will be supervised by an Oil Conservation Division Representative.