

9-17-82

Picked up Brown Oil Tool liner hanger and 4 joints 5 1/2" casing. Set liner hanger at 155' depth and set 5 1/2" casing slips with 30,000# tension pulled on 5 1/2" casing. Cut off 5 1/2" and installed tubing head. Pressure tested casing to 950 psi for 10 minutes. No bleed off. Went in hole with 3 7/8" OD blade bit, 8-3 1/8" OD drill collars and 2 3/8" tubing. Tagged up at 9436'. Drilled 35' cement to 9471'. Shut down overnight.

9-18-82

Drilled 694' cement to 10,165'. Shut down for week end.

9-20-82

Drilled 38' cement to 10,203'. Started cutting on steel. Made 6' to 10,209'. Recovered approximately 1/2 gallon steel cuttings with no cement or formation material in final returns. Closed in well and shut down overnight.

9-21-82

Went in hole with 3 7/8" OD x 3 1/4" ID rotary shoe, 5 joints 3 13/16" OD wash pipe, 8- 3 1/8" OD drill collars and 2 3/8" tubing. Made 2' new progress to 10,211'. Started pulling out of hole.

9-22-82

Completed pulling out of hole with wash pipe and rotary shoe. Fish had been approximately 1' inside shoe.

9-23-82

Had vacuum on well at 7:30 A.M. Ran overshot with 3" spiral grapple. Latched onto fish. Would pull off with 14 points weight. Pulled out of hole to check overshot. Recovered a 3" OD x 2 1/2" ID x 1 1/2" long piece of hydraulic pump barrell inside overshot. Shut down overnight.

9-24-82

Went in hole with 3 7/8" OD overshot with 3 1/16" spiral grapple, jars, 8-3 1/8" OD drill collars and 2 3/8" tubing. Tagged up at 10,211 1/2'. Worked down approximately 7'. Got one bite which held 6000# in 30 minutes of working. Pulled out of hole. Fish had just started to enter grapple. Picked up tubing spear with 2 1/2" grapple and went in hole on fishing string. Sat down at 10,212 1/2'. Worked 20 minutes without getting any hold. Shut down overnight.

9-25-82

Had slight vacuum on well at 7:30 A.M. Continued attempting to get hold of fish with spear. Could go approximately one foot deeper with spear than had been going with overshot but could not get a hold. Laid down tubing, drill collars and wash pipe. Spear appeared to have entered fish approximately 7" but not enough to engage grapple. Closed in well. Rigged down PBCP Services, Inc.

Shut down operations temporarily to make additional plans.