

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator TOM L. INGRAM	8. Farm or Lease Name Craig
3. Address of Operator POB 1757, ROSWELL, NEW MEXICO 88201	9. Well No. 1
4. Location of Well UNIT LETTER <u>K</u> , <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>27</u> TOWNSHIP <u>12S</u> RANGE <u>37E</u> NMPM.	10. Field and Pool, or Wildcat SW Gladiola-Penn
15. Elevation (Show whether DF, RT, GR, etc.) 3906 KB	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Aug. 29 to Sept. 7, 1974:

Set cast iron plug @ 10,800 w/50 sx. plug on top.
Shot 5½" casing @ 5074 and pulled.
Set 100' cement plug @ 5122-5022.
Set 100' cement plug @ 4521-4421 (8-5/8)
Shot 8-5/8" casing @ 770 and pulled.
Set 100' cement plug @ 820-720.
Set 100' cement plug @ 387-287 (13-3/8)
Set 10 sx. cement plug @ surface
Set Marker.
Mud laden brine used between plugs.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Operator DATE 9/18/74

APPROVED BY Eddie Leary TITLE OIL & GAS INSPECTOR DATE [Signature]

CONDITIONS OF APPROVAL, IF ANY: