

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input type="checkbox"/> Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE STATE REGULATION FOR PLUG BACK (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	7. Unit Agreement Name
2. Name of Operator SKELTON OIL COMPANY P. O. Box 176, Hobbs, NM 88240	8. Farm or Lease Name BOBBIE
3. Address of Operator 1500 W. Broadway Place	9. Well No. 1 #3
4. Location of Well UNIT LETTER K 1650 FEET FROM THE South LINE AND 2310 FEET FROM THE West LINE, SECTION 18 TOWNSHIP 12 S RANGE 38E NMPM.	10. Field and Pool, or Wildcat GLADIOLA WOLFCAMP
15. Elevation (Show whether DF, RT, GR, etc.) 3873	12. County LEA

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPER. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

7-31-87 Completed plug and abandon procedure per state specifications:
Dump 35' cement on CIBP set at 9805'.
Set CIBP at 9400' (+or-) and dump 35' cement.
Cement Plug w/25 sack at 7134'.
Mud to next plug. Salt Gel Mud consisting of 10# Brine and 25# Gel per bbl.
Cement Plug w/25 sacks at 4432'.
Mud to next plug.
Cement plug w/25 sacks at 3000'.
Mud to next plug.
Cement plug w/35 sacks at 2000'.
Mud to 10' from surface.
Cement to Surface w/dry hole marker.

11-20-87 Completed cleaning location: Remove pump jack/equipment from location.
Clean and level location.

I, Thereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED B. L. Skelton TITLE Owner-operator DATE 11-20-87

APPROVED BY Dan R. Smith TITLE OIL & GAS INSPECTOR DATE APR 7 1988

CONDITIONS OF APPROVAL, IF ANY: