

Brian State #1

Workover

Page 2

- 01/11/94: Trip out of hole with rods. Trip out of hole with tubing. Trip in hole with 2¼ spear (2.9" grapple), bumper sub, jars, x-over, 6 - 3½ drill collars, x-over and 175 joints 2 7/8 tubing. Circulate down tubing and wash top of fish out. Caught fish. Jarred loose at 35,000 over. Trip out of hole with ten stands. Rig up and swab tubing down to 2000'. Trip out of hole with tubing to fluid. Shut down.
- 01/12/94: Rig up and swab tubing down to 2000'. Trip out of hole with tubing. Lay down drill collars, x-over's, jars, bumper sub, spear and fish (packer, pump barrel, seating nipple, perf sub, mud anchor). Trip in hole with 18 joints tubing. Trip out of hole lay down tubing. Trip in hole with bull plug, perf sub and 160 joints 2 7/8 tubing (510.61). Flange up well head. Trip in hole with 7/8 rods. Lay down 7/8 rods. (141 rods). Trip in hole with 1" rods. Lay down 1" rods (81 rods). Shut down.
- 01/13/94: Rig down Pulling Unit.