

## BRIAN STATE #1

### Workover

- 01/03/94: Rig up Pulling Unit (Cobra Well Service). Screw on to standing valve. Trip out of hole with rods, plunger and standing valve. Release packer. Pickup one joint. Set packer with 20 points tension. Flange up well head. Drop standing valve. Trip in hole with plunger and rods. Space out. Hang well on. Pumped up in 25 minutes. Shut down.
- 01/04/94: Casing on vacuum. Packer leaking. Trip out of hole with rods, plunger and standing valve. Trip out of hole with tubing and packer. Sent packer in for repair. Shut down.
- 01/05/94: Trip in hole with packer and tubing. Set down solid at 5352 at bottom of tubing, 5292 at packer (84 stands in). Lay down nine joints tubing. Attempt to set packer with 167 joints at 5260. Would not set. Attempt to set packer with 166 joints at 5229, would not set. Shut down due to high winds.
- 01/06/94: Trip out of hole with tubing. No packer. (Came unscrewed on top of packer). Recovered top collar of packer (4.61). Trip in hole with same and attempt to screw on to packer. Trip out of hole with tubing, no packer. Trip in hole with spear (2.90 grapple) and 170 joints tubing and tag (fish has moved down hole). Attempt to spear. Trip out of hole with tubing and spear. (Dried drilling mud in end of spear). Shut down.
- 01/07/94: Trip in hole with top collar of packer and tubing. Rig up Hot Oiler and pump 30 bbls fresh water down tubing to was top of packer off. Attempt to screw on to packer. Chase packer to 5760, attempt to screw onto. Pulled off at twenty points over. Trip out of hole with tubing. Trip in hole with taper tap, bumper sub and tubing. Hit tight spot at 5300 and worked through. Caught fish. Work and try to release packer at 5760. Worked down hole to 5770. Would not release. Pulled out at 15 points over. Trip out of hole with tubing. Shut down.
- 01/10/94: Trip in hole with top collar off packer and 168 joints 2 7/8 tubing. Could not get through bad place in casing at 5360. Trip out of hole with tubing. Trip in hole with tubing open ended. (182 joints tubing). Had to turn and work through bad spot. Set down on packer. Trip in hole with standing valve catcher and 230 rods plus 18 foot to top of packer. Work and turn, could not get in packer. Shut down.