

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTFORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other	5. Lease Designation and Serial No. NM006171-A
2. Name of Operator Bristol Resources Corporation	6. If Indian, Allottee or Tribe Name
3. Address and Telephone No. (918) 492-7900 6655 South Lewis, Suite 200, Tulsa, Oklahoma 74136	7. If Unit or CA, Agreement Designation
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 660' FSL & 660' FEL Section 6 - T14S - R33E	8. Well Name and No. Featherstone Federal No. 1
	9. API Well No.
	10. Field and Pool or Exploratory Area Baum (Wolfcamp) <i>Upper Penn</i>
	11. County or Parish, State Lea County, New Mexico

12. CHECK APPROPRIATE BOX(es) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input checked="" type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

NOTIFY BLM AT (505) 393-3612 PRIOR TO ANY PLUGGING WORK.

- Set CIBP at 9,750' and cap with 35' of cement.
- Load hole with 9.0 PPG mud laden fluid.
- Cut 5-1/2" casing at 4,300'± or as determined free (top of cement at 8,890') and POOH.
- Spot 100' plug (40 sx) at top of 5-1/2" casing. TAG PLUG.
- Spot 100' plug (35 sx) at 1,675' (top of salt section). TAG PLUG.
- Cut 8-5/8" casing at 1,000' ± (top of cement at 1,080') and POOH.
- ~~Spot 10 sx plug in top at surface with a dry hole marker installed.~~
- SPOT 100' CEMENT PLUG AT THE 8 5/8" CASING STUB. TAG PLUG.
- SPOT 100' CEMENT PLUG (50' BELOW AND 50' ABOVE THE 13 3/8" CASING SHOE. TAG PLUG.
- SPOT 50' CEMENT SURFACE PLUG (FROM 50' TO THE SURFACE).
- INSTALL A DRY HOLE MARKER AND RESTORE LOCATION.

14. I hereby certify that the foregoing is true and correct

Signed Dan R. Albany Title Operations Superintendent Date 12-9-91

(This space for Federal or State office use)

Approved by _____ Title _____ Date 1-6-92

Conditions of approval, if any:

PRESENT COMPLETION
DIAGRAMATIC SKETCH

Featherstone Federal Well No. 1
460 F54EL, Sec. 6-T14S-R33E
Lea County, NM

