

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Form approved:
Budget Project N-1004-1
Effective August 1, 1985
LEASE REGISTRATION AND SERIAL

NM-01124

OF INDIAN, ACADEMIC OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for a well that is drilled or deepened at the same location as a different well.
Use "APPLICATION FOR PERMIT" for such applications.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	11. FIELD AND POOL OR WILDCAT
2. NAME OF OPERATOR Texaco Producing Inc.	12. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Lazy J Penn
3. ADDRESS OF OPERATOR PO Box 728, Hobbs, New Mexico 88240	13. COUNTY OR PARISH, STATE Lea NM
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below) At surface Unit Letter K, 1650' FSL & 2310' FWL	
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, R, GR, etc.) 4217' DF

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data.

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF	PULL OUT AFTER CASING	WATER SHUT-OFF	REPAIRING WELL
FRAC TURE TREAT	COMPLETION COMPLETE	FRAC TURE TREATMENT	ALTERING CASING
SHOOT OR ACIDIZE	ABANDON*	SHOOTING OR ACIDIZING ☒	ABANDONMENT*
REPAIR WELL	LEASE RELEASE	OTHER:	
OTHER:		*Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.	

17. DESCRIBE THE WORK DONE OR THE OPERATIONS DONE BY STATE AND PERTINENT DETAILS, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.*

Acidize Perforations at 9700'-9838'.

- 1/22/88 MIRU pulling unit. Pull rods. Install BOP. Pull tubing.
- 1/23/88 RIH with bit and casing scraper on 2 7/8" tubing to PBTD 9854'. POH. RIH with RBP and packer on 2 7/8" tubing. Set RBP at 9850'.
- 1/24/88 Set packer at 9780'. Acidize perfs 9807'-9838' with 1500 gallons of 15% NEFE acid containing 1 drum of Unichem's TW425, 1 drum of TH756, and 55 ball sealers. Release RBP and packer. Set RBP at 9787' and packer at 9603'. Acidize perfs 9700'-9771 with 2000 gallons of 15% NEFE acid, 1 drum of TW425, 1 drum TH756, and 145 ball sealers.
- 1/25/88 POH with tubing, packer, and RBP. Run production equipment.
- 1/26/88 Rig down pulling unit. Place well on production.

18. I hereby certify that the foregoing is true and correct
397-3571
SIGNED [Signature] TITLE Hobbs Area Superintendent DATE 2/2/88
(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

REC-64-180
MAR 6 - 1968
OCD
HOBBS OFFICE