ubmit 3 Copies	State of New Mexico	Form C-103
) Appropriate District Office	Energy inerals and Natural Resources Department	Revised 1-1-89
DISTRICT I	OIL CONSERVATION DIVISION	WELL API NO.
P.O. Box 1980, Hobbs, NM 88240 P.O. Box 2088		30-025-22239
DISTRICT II O. Drawer DD, Artesia, NM 88210	Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lease STATE FEE X
DISTRICT III 000 Rio Brazos Rd., Aztec, NM 87410		6. State Oil & Gas Lease No.
(DO NOT USE THIS FORM FOR PF DIFFERENT RESE	TICES AND REPORTS ON WELLS ROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO , ERVOIR. USE "APPLICATION FOR PERMIT" C-101) FOR SUCH PROPOSALS.)	A 7. Lease Name or Unit Agreement Name
. Type of Well: OL GAS WELL X WELL	OTHER	Sanders AOU
Name of Operator		8. Well No.
YATES PETROLEUM CORPO	DRATION	9. Pool name or Wildcat
. Address of Operator 105 South 4th St., Ar	tesia, NM 88210	Saunders Permo Upper Penn
. Well Location		
Unit Letter :	80 Feet From The North Line and	1980 Feet From The West Line
Survive 1	Township 14S Range 33E	NMPM Lea County
Section 1	10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
	4185' GR	
	k Appropriate Box to Indicate Nature of Notice	Report, or Other Data
NOTICE OF IN	NTENTION TO: S	
		ALTERING CASING
	Lease J	
PULL OR ALTER CASING	CASING TEST AN	
		, Fv
DTHER:	ОТНЕЯ: <u></u> Re-е	ntry X
12. Describe Proposed or Completed Op		
12. Describe Proposed or Completed Op work) SEE RULE 1103. 11-28-95 - Welded on lines to re-entry ta on surface plug at 2 tagged cement plug a and reaming down.	perations (Clearly state all pertinent details, and give pertinent dates, n 12" X 3000 starting head. Nippled ank. Picked up 11" mill tooth bit wi 2:00 PM 11-27-95. Drilled 5' and fel at 315'. Drilled solid cement and fe	up BOP. Installed 3" value and th 4-3/4" drill collars. Spudded out of plug. Washed down and all out of plug at 492'. Washing
12. Describe Proposed or Completed Op work) SEE RULE 1103. 11-28-95 - Welded on lines to re-entry ta on surface plug at 2 tagged cement plug a and reaming down. 11-29-95 - Drilled f 11-30-95 - Washed an ulate clean. TOOH. 4-3/4" bowl and jars into stub. Drilled and laid down mill	perations (Clearly state all pertinent details, and give pertinent dates, 1 12" X 3000 starting head. Nippled ank. Picked up 11" mill tooth bit wi 2 00 PM 11-27-95. Drilled 5' and fel	including estimated date of starting any proposed up BOP. Installed 3" valve and th 4-3/4" drill collars. Spudded 1 out of plug. Washed down and ell out of plug at 492'. Washing d reaming down. at 1544'. Rotate on stub. Circ- ilot collar, 10-3/4" OD pilot mill g. Tagged stub and worked bit Milled 5' off top of stub. TOOH IH with 10-3/4" X 4' slip joint and
12. Describe Proposed or Completed Op work) SEE RULE 1103. 11-28-95 - Welded on lines to re-entry ta on surface plug at 2 tagged cement plug a and reaming down. 11-29-95 - Drilled f 11-30-95 - Washed an ulate clean. TOOH. 4-3/4" bowl and jars into stub. Drilled and laid down mill a 23 joints of 8-5/8" down casing.	perations (Clearly state all periment details, and give periment dates, h 12" X 3000 starting head. Nippled ank. Picked up 11" mill tooth bit wi 2:00 PM 11-27-95. Drilled 5' and fel at 315'. Drilled solid cement and fe from 920-1003'. Continue washing and nd reamed down. Tagged 8-5/8" stub a TIH with 7-7/8" bit, 6" OD X 10' pi s, 14 4-3/4" drill collars and tubing 10' of cement. Fell out of cement. and jars. Rigged up casing crew. Th 32# casing to 1035'. Could not get	including estimated date of starting any proposed up BOP. Installed 3" valve and th 4-3/4" drill collars. Spudded 1 out of plug. Washed down and ell out of plug at 492'. Washing 1 reaming down. at 1544'. Rotate on stub. Circ- ilot collar, 10-3/4" OD pilot mill g. Tagged stub and worked bit Milled 5' off top of stub. TOOH IH with 10-3/4" X 4' slip joint and past tight spot. TOOH and laid
12. Describe Proposed or Completed Op work) SEE RULE 1103. 11-28-95 - Welded on lines to re-entry ta on surface plug at 2 tagged cement plug a and reaming down. 11-29-95 - Drilled f 11-30-95 - Washed an ulate clean. TOOH. 4-3/4" bowl and jars into stub. Drilled and laid down mill a 23 joints of 8-5/8" down casing.	perations (Clearly state all periment details, and give periment dates, h 12" X 3000 starting head. Nippled ank. Picked up 11" mill tooth bit wi 2:00 PM 11-27-95. Drilled 5' and fel at 315'. Drilled solid cement and fe from 920-1003'. Continue washing and nd reamed down. Tagged 8-5/8" stub a TIH with 7-7/8" bit, 6" OD X 10' pi s, 14 4-3/4" drill collars and tubing 10' of cement. Fell out of cement. and jars. Rigged up casing crew. Th 32# casing to 1035'. Could not get	including estimated date of starting any proposed up BOP. Installed 3" valve and th 4-3/4" drill collars. Spudded 1 out of plug. Washed down and ell out of plug at 492'. Washing d reaming down. at 1544'. Rotate on stub. Circ- ilot collar, 10-3/4" OD pilot mill g. Tagged stub and worked bit Milled 5' off top of stub. TOOH IH with 10-3/4" X 4' slip joint and
 12. Describe Proposed or Completed Opwork) SEE RULE 1103. 11-28-95 - Welded on lines to re-entry ta on surface plug at 2 tagged cement plug at and reaming down. 11-29-95 - Drilled filt-30-95 - Washed an ulate clean. TOOH. 4-3/4" bowl and jars into stub. Drilled and laid down mill a 23 joints of 8-5/8" down casing. 1 hereby certify that the information above in the stub. 	perations (Clearly state all periment details, and give periment dates, h 12" X 3000 starting head. Nippled ank. Picked up 11" mill tooth bit wi 2:00 PM 11-27-95. Drilled 5' and fel at 315'. Drilled solid cement and fe from 920-1003'. Continue washing and nd reamed down. Tagged 8-5/8" stub a TIH with 7-7/8" bit, 6" OD X 10' pi s, 14 4-3/4" drill collars and tubing 10' of cement. Fell out of cement. and jars. Rigged up casing crew. Th 32# casing to 1035'. Could not get is the and complete to the best of my knowledge and belief. Mun. mrg. Production	including estimated date of starting any proposed up BOP. Installed 3" valve and th 4-3/4" drill collars. Spudded 1 out of plug. Washed down and ell out of plug at 492'. Washing 1 reaming down. at 1544'. Rotate on stub. Circ- ilot collar, 10-3/4" OD pilot mill g. Tagged stub and worked bit Milled 5' off top of stub. TOOH IH with 10-3/4" X 4' slip joint and past tight spot. TOOH and laid
 12. Describe Proposed or Completed Opwork) SEE RULE 1103. 11-28-95 - Welded on lines to re-entry ta on surface plug at 2 tagged cement plug at and reaming down. 11-29-95 - Drilled file file file file file for the state of the	perations (Clearly state all periment details, and give periment dates, h 12" X 3000 starting head. Nippled ank. Picked up 11" mill tooth bit wi 2:00 PM 11-27-95. Drilled 5' and fel at 315'. Drilled solid cement and fe from 920-1003'. Continue washing and nd reamed down. Tagged 8-5/8" stub a TIH with 7-7/8" bit, 6" OD X 10' pi s, 14 4-3/4" drill collars and tubing 10' of cement. Fell out of cement. and jars. Rigged up casing crew. Th 32# casing to 1035'. Could not get is the and complete to the best of my knowledge and belief. Mun. mrg. Production	up BOP. Installed 3" valve and th 4-3/4" drill collars. Spudded 1 out of plug. Washed down and ell out of plug at 492'. Washing d reaming down. at 1544'. Rotate on stub. Circ- ilot collar, 10-3/4" OD pilot mill g. Tagged stub and worked bit Milled 5' off top of stub. TOOH IH with 10-3/4" X 4' slip joint and past tight spot. TOOH and laid

