

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	
2. Name of Operator Read & Stevens, Inc.	
3. Address of Operator P. O. Box 2126, Roswell, New Mexico, 88201	
4. Location of Well UNIT LETTER B , 660 FEET FROM THE North LINE AND 1980 FEET FROM THE East LINE, SECTION 15 TOWNSHIP 12 South RANGE 33 East NMPM.	
15. Elevation (Show whether DF, RT, GR, etc.) 4256.4 Ground	

7. Unit Agreement Name None
8. Farm or Lease Name Natural
9. Well No. 1
10. Field and Pool, or Wildcat Bagley Penn
12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Received permission to P&A via telephone from Mr. Joe Ramey.
- Set C.I. bridge plug @ 8700'. Set 40' of cement on top of plug.
- Load hole thru tubing w/salt mud. Mud mixed 1 sk. of Gel to 4 bbls. brine water.
- Cut 5-1/2" casing @ free point.
- Set 35 sx. cement plug 50' in and 50' out of 5-1/2" stub.
- Set 35 sx. cement plug 5220' to 5120'.
- Set 35 sx. cement plug 2915' to 3815' (across 8-5/8" shoe).
- Cut and pull 8-5/8".
- Set 35 sx. cement plug 50' in and 50' out of 8-5/8" stub.
- Set 35 sx. cement plug 450' to 350' (across surface shoe).
- Set 10 sx. cement plug 10' to 0'.
- Install regulation marker and clean location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Carla Schellinger TITLE Agent DATE July 6, 1972

Orig. Signed by
John Runyan
Geologist

APPROVED BY _____ TITLE _____ DATE JUL 10 1972

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

JUL - 7 1972

OIL CONSERVATION COMM.
HOUSE, W. VA.

120

