

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO. <u>30-025.22746</u>
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. <u>OG-4637</u>
7. Lease Name or Unit Agreement Name <u>COASTAL STATES</u>
8. Well No. <u>1</u>
9. Pool name or Wildcat <u>BAUM UPPER PENN</u>

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator <u>PENROC OIL CORP.</u>	
3. Address of Operator <u>P.O. Box 5970 Hobbs NM 88241</u>	
4. Well Location Unit Letter <u>0</u> : <u>660</u> Feet From The <u>SOUTH</u> Line and <u>1980</u> Feet From The <u>EAST</u> Line Section <u>1</u> Township <u>14 S</u> Range <u>32 E</u> NMPM <u>Lea</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8.6.96 THRU 8.12.96

RU Pulling unit. Released anchor pulled tag. (332 jts.)
All wireline & set CIBP @ 9780'. 2 bailer run - 35 sx. cement on top.
Cut 5 1/2" head. & RU wireline 8/8/96 - Ran free point. Free 4500'.
Out 5 1/2" & rec. 4500' of same. TTH w/ tag to set cement inside 5 1/2".
Could not. TTH & TTH w/ 4' mule shoe - work thru cut off csg. to 6700' - mix
& set 25 sx. plug. Pulled to stub & layed down & set another 50 sx.
@ stub. W.O.C. & tagged - O.K. On 8.10.96 set 50 sx. from 4000-4100'.
W.O.C. & tagged @ 3990'. 8.11.96 RU wireline perf. 2 hrs @ 390'. pu pkry &
set same @ 375'. Pumped 25 sx. into csg. & 50 sx. outside. W.O.C. Pulled pk
Tagged @ 301' set 20 sx. @ surface. Install DH marker. R.D. Clean loc.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Inspector DATE 8/15/96

TYPE OR PRINT NAME

TELEPHONE NO.

(This space for State Use)

APPROVED BY [Signature] TITLE _____ DATE JAN 03 2002

CONDITIONS OF APPROVAL, IF ANY:

TO S