

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. K-4177
7. Lease Name or Unit Agreement Name State "8"
8. Well No. 2
9. Pool name or Wildcat Baum (U. Penn)

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator Coastal Oil & Gas Corporation	
3. Address of Operator P.O. Box 235, Midland, Texas 79702	
4. Well Location Unit Letter <u>B</u> : <u>660</u> Feet From The <u>North</u> Line and <u>1980'</u> Feet From The <u>East</u> Line Section <u>8</u> Township <u>14-S</u> Range <u>33-E</u> NMPM <u>Lea</u> County <u></u>	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4263' KB	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 3-6-89 RU Plugging Unit. POOH with tbg. RU WL, set CIBP at 9440'. GIH with tbg.  
3-7-89 Spot 10 sack plug on top of CIBP (TOC 9339'). Load hole with 10 PPG gelled brine. POOH. Weld on to 5-1/2" csg, pull stretch and calculate free point. Shoot csg at 4089'.  
3-8-89 POOH and LD 125 jts 5-1/2" csg (4088'). GIH with tbg to 6437', spot 25 sack plug 6437-6191'.  
3-9-89 Pick up tbg to 4156' and spot 40 sack plug. WOC 3 hrs and tag plug at 4015' (5-1/2" stub at 4089', 8-5/8" shoe at 4075'). POOH. Weld on to 8-5/8" csg.  
3-10-89 Pull stretch and make cut at 672'. POOH and LD 21 jts 8-5/8" csg. GIH with tbg to 1753' and spot 30 sack plug. PU to 735' and spot 80 sack plug.  
3-13-89 GIH with tbg, tag 8-5/8" stub plug at 601'. PU to 428' and spot 75 sack shoe plug. WOC 3 hrs and tag cmt at 304'. Spot 10 sack surface plug. Installed P&A Marker, cleaned location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bobby L. Smith TITLE Area Superintendent DATE 3-20-89  
TYPE OR PRINT NAME Bobby L. Smith (915)  
TELEPHONE NO. 682-7925

(This space for State Use)

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE APR 7 1989  
CONDITIONS OF APPROVAL, IF ANY:

R N

B

RECEIVED

MAR 22 1989

OCD  
HOBBS OFFICE