

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.

5. Indicate Type of Lease  
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.  
K1955

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name

New Mexico "JJ" State

1. Type of Well:  
OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator  
Ginger Petroleum Company, Inc.

8. Well No.

1

3. Address of Operator  
P.O. Box 827, La Grange, TX 78945

9. Pool name or Wildcat

Baum-Upper Pennsylvania

4. Well Location  
Unit Letter 0 : 660 Feet From The South Line and 1980 Feet From The East Line

Section 23 Township 13S Range 32E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4309.5 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set CIBP @ 9700' (2/27/89). Dump 5 sx w/dump bailer.
2. Load hole w/10#/gallon mud.
3. Cut csg. @ 5227', work loose (3/11/89). Pull 157 jts 5½" csg.
4. Run tbg. to 5350'. Spot 45 sx plug, tag @ 5110' (3/14/89). Pull tbg. to 4050', mix 35 sx.
5. Tag shoe plug at 3900'. Pull tbg. to 2500', Mix and pump 30 sxs, shoot 8-5/8" @ 502'.
6. Cut 8-5/8" 440', 409', and 315'.
7. Cut 8-5/8" 220'. Run tbg. to 550', mix and pump 75 sxs.  
Pull tbg. Run to 250', mix and pump 25 sxs.
8. 10 Sxs in surface. Cut dead men, wellhead off. Install dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Steve Hillhouse TITLE Vice President DATE 3/31/89

TYPE OR PRINT NAME Steve Hillhouse

TELEPHONE NO. 409/242-5528

(This space for State Use)

APPROVED BY

OIL & GAS INSPECTOR

APR 6 1989

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: