

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator Sun Exploration & Production Company		8. Farm or Lease Name New Mexico JJ State
3. Address of Operator P.O. Box 1861 Midland, Texas 79702		9. Well No. 1
4. Location of Well UNIT LETTER 0 660 FEET FROM THE South LINE AND 1980 FEET FROM THE East LINE, SECTION 23 TOWNSHIP 13S RANGE 32E NMPM.		10. Field and Pool, or Wildcat Baum (Upper Penn)
15. Elevation (Show whether DF, RT, GR, etc.) 4309.5 GR		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1503.

NOTE: Plugging procedure discussed w/ Eddy Seay, N.M.O.C.C.  
(505/393-6161) 6/01/88.

- MIRU PU. POH W/ RODS & PUMP. LD RODS & WAREHOUSE. NU BOP. RLSE TAC & POH W/ 2-3/8" & 2-7/8" TBG.
- RIH W/ 5-1/2" CIBP ON WL. SET PLUG @ ±9700'. SPOT 5 SX CMT VIA DUMP BAILER ON TOP. RIH W/ TBG. DISPLACE HOLE W/ 10#/GAL MUD-LADEN FLUID. POH.
- DETERMINE FREE POINT OF PROD CSG. RIH W/ CSG CUTTER & CUT CSG @ FREE PT. POH W/ CSG LD.
- RIH W/ 2-3/8" & 2-7/8" TBG OE TO ±9640'. SPOT 100' PLUG W/ 50' BELOW THE STUB & 50' ABOVE THE STUB (±18 SX). WOC. TAG-PLUG W/ TBG.
- SPOT 100' PLUG FROM ±5350' TO ±5250' (±25 SX). SPOT 100' PLUG FROM ±4040' TO ±3940' (±26 SX). WOC. TAG PLUG W/ TBG. SPOT 100' PLUG FROM ±2500' TO ±2400' (±26 SX). POH.

THE COMMISSION MUST BE NOTIFIED  
24 HOURS PRIOR TO COMMENCING WORK

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Paul Kautz TITLE Accounting Associate DATE 7/21/88

Orig. Signed by  
Paul Kautz  
Geologist

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE AUG 01 1988

CONDITIONS OF APPROVAL, IF ANY:

8861 2 2 JUL  
HOBBS OFFICE

Form C-103  
Page 2

NEW MEXICO JJ STATE #1  
LEA COUNTY, NEW MEXICO

6. PERF 4 SQZ HOLES @  $\pm 475'$ . SET CMT RET @  $\pm 360'$ . EIR. SQZ PERFS & ATTEMPT TO CIRC CMT TO SURF OUT BRADENHEAD. SPOT 5 SX CMT ON TOP OF RET. SPOT 10 SX PLUG @ SURFACE. POH.
7. CUT OFF WELLLHEAD 4' BGL & WELD ON STEEL PLATE. INSTALL DRY HOLE MARKER. CLN LOCATION. RLSE RIG.