

COPIES RECEIVED	
DISTRIBUTION	
SALE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

3 - NM OCC
1 - File

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
7. Unit Agreement Name
8. Farm or Lease Name State "BH"
9. Well No. 2
10. Field and Pool, or Wildcat Baum Upper Penn
12. County Lea

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator Getty Oil Company
3. Address of Operator P. O. Box 249, Hobbs, N. Mex. 88240
4. Location of Well UNIT LETTER F 1980 FEET FROM THE North LINE AND 1980 FEET FROM THE West LINE, SECTION 12 TOWNSHIP 14S RANGE 32E NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 4280 Gr.

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8-1-74 - Set 5-1/2" cast iron bridge plug @ 9850'. Dumped 4 sacks cement on top of bridge plug. Fill-up to 9815'. Filled 5-1/2" casing with 228 barrels mud. Free point determined pipe free at 7800'. Shot off in collar @ 7785'. Pulled 203 joints of 5-1/2" casing. Laid 100' (35 sacks cement) plug from 7835' back to 7735'. (50' in and out of 5-1/2" casing stub). Laid 100' (35 sacks cement) plug from 5500' back to 5400', in top of Glorieta. Tagged top of cement at 5400', OK. Laid 100 sack cement plug from 4147' back to 4047'. 50' in and out of 8-5/8" casing shoe @ 4097'. Shot 8-5/8" casing at 700', could not pull. Shot again at 597'. Pulled 16-1/2 joints of 8-5/8" casing. Laid 45 sack cement plug from 647' back to 547'. 50' in and out of 8-5/8" casing stub at 597'. Laid 64 sack cement plug from 447' back to 347'; 50' in and out of 13-3/8" shoe @ 397'. Laid 10' cement plug at surface and set dry hole marker.

Waiting on mud pit to dry out before making final cleanup.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original Signed By

SIGNED O. L. WADE TITLE Area Superintendent DATE 8-9-74

APPROVED BY Nathan E. Clegg TITLE Area Superintendent DATE FEB 20 1975

CONDITIONS OF APPROVAL, IF ANY: