

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION
3-NMOCC
1-File

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator GETTY OIL COMPANY	8. Farm or Lease Name STATE "BH"
3. Address of Operator P.O. BOX 249, HOBBS, NEW MEXICO 88240	9. Well No. 2
4. Location of Well UNIT LETTER F, 1980 FEET FROM THE NORTH LINE AND 1980 FEET FROM THE WEST LINE, SECTION 12 TOWNSHIP 14S RANGE 32E NMPM.	10. Field and Pool, or Wildcat BAUM UPPER PENN
15. Elevation (Show whether DF, RT, GR, etc.) 4280 GR.	12. County LEA

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOBS ☐ OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

It is proposed to P & A this well as follows:

- Rig up double drum unit and set B.P. on wireline at 9850' and dump 35 feet of cement on top B.P.
- Load hole with mud after 4 hours W.O.C.
- Tie on to casing and run free point indicator and shoot off casing and pull 5-1/2' casing.
- Run tubing and spot 100' cement plug at casing cut 50' in and 50' out.
- Pick up tubing and spot 100 foot @ cement plug in top of Glorietta 5400'-5500'. W.O.C. 4 hours and tag cement plug.
- Pull tubing to casing cut and spot 100' cement plug at shoe of intermediate casing 4097'. Cement plug from 4047' to 4147'.

(CONTINUED ON BACK)

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

ORIGINAL SIGNED BY:

SIGNED C. L. Wade: C. L. Wade TITLE AREA SUPERINTENDENT DATE JULY 30, 1974

APPROVED BY: TITLE: DATE:

CONDITIONS OF APPROVAL, IF ANY:

BMV/bh

- G. Pull tubing and tie into 8-5/8" intermediate casing.
- H. Locate Free point of 8-5/8" casing; shoot off; and pull casing.
- I. Run tubing and spot 100' of cement plug at 8-5/8" cut, 50 feet cement in casing and 50 feet out of casing.
- J. *100' plug in & out of surface shoe*
Pull tubing and spot 10 sxs. of cement at surface.
- K. SALVAGE BRADENHEAD and erect "DRY HOLE" MARKER. Fill Cellar and clear location.