

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-10;
Supersedes Old
C-102 and C-103
Effective 1-1-65

<p align="center">SUNDRY NOTICES AND REPORTS ON WELLS</p> <p align="center"><small>(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)</small></p>		<p>5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/></p> <p>5. State Oil & Gas Lease No. K544</p>
<p>1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/></p> <p>2. Name of Operator Janison & Caffey, Inc.</p> <p>3. Address of Operator 420 N. Shipp, Hobbs, NM 88240</p> <p>4. Location of Well UNIT LETTER H 1874 FEET FROM THE North LINE AND 766 FEET FROM THE East LINE, SECTION 8 TOWNSHIP 14S RANGE 34E N.M.P.M.</p>		<p>7. Unit Agreement Name</p> <p>8. Firm or Lease Name Tenneco st</p> <p>9. Well No. 1</p> <p>10. Field and Pool, or Wildcat Cerca Penn</p>
<p>15. Elevation (Show whether DF, RT, GR, etc.) 4146 gl</p>		<p>11. County Lea</p>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
-------------------------	-----------------------

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

16. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. set cast iron plug @ 10,200 & dumped 35' of cement
2. loaded hole with 9.7# mud
3. pulled 6170 of 5 1/2 casing
4. spot 50 sx plug @ 6244 tagged @ 6120
spot 35 sx plug @ 5810
spot 50 sx plug @ 4470 tag @ 4355
5. pulled 700' of 8 5/8 casg.
6. spot 35 sx plug @ 1350
spot 70 sx plug @ 750 tag @ 670
spot 90 sx plug @ 410 tag @ 300
7. spot 10 sx @ Surf with dry hole marker
8. clean up location

17. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Bill Janison</u>	TITLE <u>vice-pres.</u>	DATE <u>1-26-79</u>
APPROVED BY <u>John W. Runyan</u>	TITLE <u>Geologist</u>	DATE <u>MAY 17 1979</u>

CONDITIONS OF APPROVAL, IF ANY: