

Submit 3 Copies  
to Appropriate  
District Office

Energy, Minerals and Natural Resources Department

Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

# OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

Well API NO.

30-025-23327

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

L 110

7. Lease Name or Unit Agreement Name

State "36"

8. Well No.

1

9. Pool name or Wildcat

Baum (U. Penn)

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OR

WELL ☒

GAS

WELL ☐

OTHER

2. Name of Operator

Coastal Oil & Gas Corporation

3. Address of Operator

P.O. Box 235, Midland, Texas 79702

4. Well Location

Unit Letter G : 1980 Feet From The North Line and 1980 Feet From The East Line

Section 36

Township 13-S

Range 32-E

NMNM

Lea

County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4291.8 Gr.

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

### NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

### SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Note: Bought "C" perms 9826-34 and 9854-64.

1. Set CIBP at 9799'. Circulated hole with 177 bbl 10 PPG salt gel mud.
2. Spotted 10 sack cement plug on top of CIBP.
3. Spotted 25 sack cement plug at 7000'-6800'.
4. Perf squeeze holes at 4100' and 410'. GIH with packer. Pump in to perms at 4100', establish rate, POOH with packer.
5. GIH with retainer, set ret at 4010', squeeze perms with 100 sacks.
6. Spotted 25 sack plug 1100'-1000'.
7. Squeezed perms at 4100' with 100 sack plug. WOC overnight, tagged cmt at 100' from surface.
8. Removed wellhead equipment. Spotted 10 sack surface plug, installed P&A marker. Work completed 11-29-91.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

*Bobby L. Smith*

TITLE Sr. Petroleum Engineer

DATE 12-4-91

TYPE OR PRINT NAME

Bobby L. Smith

TELEPHONE NO. 915-682-7925

(This space for State Use)

APPROVED BY

*Jace Griffin*

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: