

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

3a. Indicate Type of Lease  
State ☒ Fee ☐

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator

Sabine Petroleum Corp

3. Address of Operator

P.O. Box 3083, Midland, Texas 79705

4. Location of Well

UNIT LETTER N 660 FEET FROM THE S LINE AND 1980 FEET FROM  
THE W LINE, SECTION 36 TOWNSHIP 13S RANGE 32E N.M.P.M.

7. Unit Agreement Name

8. Farm or Lease Name

Paris State

9. Well No.

#2

10. Field and Pool, or adjacent

Baum Upper (Penn)

15. Elevation (Show whether DF, RT, GR, etc.)

4300 DF

12. County

Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

TEMPORARILY ABANDON ☐

PULL OR ALTER CASING ☐

PLUG AND ABANDON ☒

CHANGE PLANS ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

COMMENCE DRILLING OPS. ☐

CASING TEST AND CEMENT JOBS ☐

OTHER ☐

ALTERING CASING ☐

PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1). Move in & rig up plugging equipment.
- 2). Set C.I.B.P. @ 9250'. Cap with 35' of cement.
- 3). R.I.H. with tubing, mix mud using 25# salt gel/bbl of 10# brine. Circulate hole with mud.
- 4). Spot 25 sack plug at 7605' - 7450'.
- 5). Cut and P.O.H. with 5½" casing.
- 6). Spot a 45 sack plug in and out of the 5½" casing stub.
- 7). P.U.H. to 5503' and spot a 45 sack plug.
- 8). P.U.H. to 4105' and spot a 65 sack plug to 4000'. W.O.C. & tag.
- 9). Cut & P.O.H. with the 8 5/8" casing.
- 10). R.I.H. with tubing to the 8 5/8" stub and spot a 75 sack plug in and out of stub. W.O.C. & tag.
- 11). R.I.H. with tubing to 437'. Spot a 85 sack plug. W.O.C. & tag.
- 12). Cut off wellhead, place 15 sack surface plug. Install dry hole marker.
- 13). Rig down, clean location & move off.

NO OTHER WORK TO BE DONE  
ON THIS WELL AT THIS TIME  
IT IS THE POLICY OF THE OCS  
TO BE MAINTAINED.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Mark Olson

TITLE Drilling Engineer

DATE 9-10-85

Eddie W. Seay

APPROVED BY Oil & Gas Inspector

TITLE

DATE SEP 11 1985

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

SEP 11 1985

O.C.D.  
HOBBS OFFICE