DISTRIBUTION		Form C-103 Supersedes Old	
SANTAFE	NEW MEXICO OIL CONSERVATION	C-102 and C-103 COMMISSION Effective 1-1-65	
FILE			
U.S.G.S.		Sa, Indicate Type of Lease	,
LAND OFFICE		State XX	ee 📗
OPERATOR		5. State Oil & Gas Lease No.	
		State K-4480	
	RY NOTICES AND REPORTS ON WELLS OPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFF TION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)		
OIL GAS WELL WELL	отнея-	7. Unit Agreement Name	
2. Name of Operator		8. Farm or Lease Name	
Sabine Production Cor	mpany	Paris State	
•	land Toyog 70702	9, Well No.	
P. O. Box 3083 - Mid	Idild, Texas 79702	2 10. Field and Pool, or Wilded	, , , , , , , , , , , , , , , , , , ,
	660 FEET FROM THE South LINE AND		
THE West LINE, SECTI	ON TOWNSHIP 13-S	32-E	
mmmmmmm	15. Elevation (Show whether DF, RT, GR,		<i>HH</i>
	4299' GR	etc.) 12. County Lea	
Check	Appropriate Box To Indicate Nature of N	otice, Report or Other Data	
	NTENTION TO:	SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON REMEDIAL W	ORK ALTERING CASING	
TEMPORARILY ABANDON		BRILLING OPNS. PLUG AND ABANDONA	ENT
PULL OR ALTER CASING	[]	AND CEMENT JOS	
Plug back & Perforate	a linner 70ne	\rightarrow	X
OTHER DAGIT & TELLOTAGE	- opper zone	,	•
17. Describe Proposed or Completed O	perations (Clearly state all pertinent details, and give	pertinent dates, including estimated date of starting any	proposed
work) SEE RULE 1103.			
8-15-80 MI&RU	s the Cot CIDD A 07271 Descrip	/II D) 0550 CA G () 7 1 3	
0-10 FOOT - 1005, putip 6			11511
PETER MISSON I. SIIII 71	s tog. Set CIBP @ 9/3/. Period	(Upper Penn) 9552-64. Set Model	"R"
8-18 AC 9552-64 w/1000	ts 2-7/8" tbg. TP 9421. Prep to	acidize.	
8-18 Ac 9552-64 w/1000 g	ts 2-7/8" tbg. TP 9421. Prep to	(Upper Penn) 9552-64. Set Model acidize. KCL. Reset pkr w/20,000#. Swbg b	
8-18 Ac 9552-64 w/1000 q load (178 bbls).	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2%	acidize. KCL. Reset pkr w/20,000#. Swbg b	
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed $w/2$ % 3000 gal 15% HCL, 4800 psig & ble	acidize. KCL. Reset pkr w/20,000#. Swbg b w hole in tbg. Replaced jts and	
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig	acidize. KCL. Reset pkr w/20,000#. Swbg b w hole in tbg. Replaced jts and	
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ peri 8-20 Recovered load & sw 8-21 Ran GR, Collar Log	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13	acidize. KCL. Reset pkr w/20,000#. Swbg bew hole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai	ack 1
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ peri 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0	acidize. KCL. Reset pkr w/20,000#. Swbg bow hole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai gal 15% HCL. Op by pass on pkr	ack 1
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ peri 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac t	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe	acidize. KCL. Reset pkr w/20,000#. Swbg bow hole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by.pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig.	ack 1
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ perd 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac t 8-22 Swbd load. FL-7000	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/	acidize. KCL. Reset pkr w/20,000#. Swbg bow hole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by.pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig.	ack 1
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ peri 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac t 8-22 Swbd load. FL-7000 set anchor @ 9,528'	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 c & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/'.	acidize. KCL. Reset pkr w/20,000#. Swbg bow hole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by.pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig.	ack 1
8-18 Ac 9552-64 w/1000 of load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ perf 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac t 8-22 Swbd load. FL-7000 set anchor @ 9,528'8-23 Ran pump & rods - p	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 c & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/'.	acidize. KCL. Reset pkr w/20,000#. Swbg bow hole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by.pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig.	ack 1
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ peri 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac t 8-22 Swbd load. FL-7000 set anchor @ 9,528'	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 c & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/'.	acidize. KCL. Reset pkr w/20,000#. Swbg bow hole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by.pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig.	ack 1
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ peri 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac t 8-22 Swbd load. FL-7000 set anchor @ 9,528' 8-23 Ran pump & rods - p 8-24 Pmpg 100% water thru	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/1. put on prod.	acidize. KCL. Reset pkr w/20,000#. Swbg be whole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by-pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig. Baker tbg anchor & 2-7/8" tbg &	ack 1
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ peri 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac t 8-22 Swbd load. FL-7000 set anchor @ 9,528' 8-23 Ran pump & rods - p 8-24 Pmpg 100% water thru	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/1. put on prod.	acidize. KCL. Reset pkr w/20,000#. Swbg bow hole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by.pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig.	ack 1
8-18 Ac 9552-64 w/1000 c load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ peri 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac t 8-22 Swbd load. FL-7000 set anchor @ 9,528' 8-23 Ran pump & rods - peri 8-24 Pmpg 100% water thru 9-5 FL @ 9,333'. CP 4	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/1. put on prod.	acidize. KCL. Reset pkr w/20,000#. Swbg be whole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by-pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig. Baker tbg anchor & 2-7/8" tbg &	ack 1
8-18 Ac 9552-64 w/1000 of load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ period acid @ pipe, Model "R" Pkr Circ & spotted ac to acid & sworth acid & spotted & s	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 c & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/'. put on prod. psig. P/O BOPD + 176 BWPD. Will	acidize. KCL. Reset pkr w/20,000#. Swbg be whole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig. Baker tbg anchor & 2-7/8" tbg & continue to pump, if no oil show	ack 1
8-18 Ac 9552-64 w/1000 of load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ period acid @ pipe, Model "R" Pkr Circ & spotted ac to acid & sworth acid & spotted & s	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/1. put on prod.	acidize. KCL. Reset pkr w/20,000#. Swbg be whole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig. Baker tbg anchor & 2-7/8" tbg & continue to pump, if no oil show	ack 1
8-18 Ac 9552-64 w/1000 of load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ perf 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac to 8-22 Swbd load. FL-7000 set anchor @ 9,528' 8-23 Ran pump & rods - results and swatch set anchor with the se	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/'. Dut on prod. psig. P/O BOPD + 176 BWPD. Will	acidize. KCL. Reset pkr w/20,000#. Swbg be whole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by-pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig. Baker tbg anchor & 2-7/8" tbg & continue to pump, if no oil show	ack 1
8-18 Ac 9552-64 w/1000 of load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ perf 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac to 8-22 Swbd load. FL-7000 set anchor @ 9,528' 8-23 Ran pump & rods - results and swatch set anchor with the se	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 & 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Pe 0'. Unset pkr & POOH. Ran in w/'. Dut on prod. psig. P/O BOPD + 176 BWPD. Will	acidize. KCL. Reset pkr w/20,000#. Swbg be whole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig. Baker tbg anchor & 2-7/8" tbg & continue to pump, if no oil show	ack 1
8-18 Ac 9552-64 w/1000 of load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ perf 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac to 8-22 Swbd load. FL-7000 set anchor @ 9,528' 8-23 Ran pump & rods - perf 8-24 Pmpg 100% water thru 9-5 FL @ 9,333'. CP 4 will SI.	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 to 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Perol'. Unset pkr & POOH. Ran in w/2. Dut on prod. psig. P/O BOPD + 176 BWPD. Will	acidize. KCL. Reset pkr w/20,000#. Swbg be whole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig. Baker tbg anchor & 2-7/8" tbg & continue to pump, if no oil show	ack
8-18 Ac 9552-64 w/1000 of load (178 bbls). 8-19 FL @ 7700' - Ac w/3 spotted acid @ perf 8-20 Recovered load & sw 8-21 Ran GR, Collar Log pipe, Model "R" Pkr Circ & spotted ac to 8-22 Swbd load. FL-7000 set anchor @ 9,528' 8-23 Ran pump & rods - results and swatch set anchor with the se	ts 2-7/8" tbg. TP 9421. Prep to gal 15% HCL, 0 psig, flushed w/2% 3000 gal 15% HCL, 4800 psig & ble fs & Ac 0.3 to 0.6 BPM @ 500 psig wbd dry. & reperf'd 9552-64 w/1 JSPF (13 to 2-7/8" tbg @ 9570'. Ac w/1,0 to perfs. Closed by-pass & Ac Perol'. Unset pkr & POOH. Ran in w/2. Dut on prod. psig. P/O BOPD + 176 BWPD. Will	whole in tbg. Replaced jts and holes). Ran in hole w/4 jts of tai 00 gal 15% HCL. Op by-pass on pkr nn @ 1.0 to 0.8 BPM & 3500 psig. Baker tbg anchor & 2-7/8" tbg & continue to pump, if no oil show	ack