

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-79

5a. Indicate Type of Lease  
State ☒ Fee ☐  
5. State Oil & Gas Lease No.  
~~K-3013~~ V-779

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Dwight A. Tipton	8. Farm or Lease Name New Mexico 86 State
3. Address of Operator c/o Oil Reports & Gas Services, Inc., Box 755, Hobbs, NM 88241	9. Well No. 1
4. Location of Well UNIT LETTER <u>F</u> , <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>33</u> TOWNSHIP <u>14S</u> RANGE <u>34E</u> NMPM.	10. Field and Pool, or Wildcat Tres Papalotes Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4125 DF	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Work began 5/31/88. Ran impression block, top of fish at 6007. Ran tubing open ended, mix & pump 35 sacks gel mixed in 125 bbls fresh water. Displace fluid in hole, pull tubing. Set Cement retainer at 6000. Load hole with mud. Spot 200 sacks cement below retainer and 50' above retainer. Cut & pull 5 1/2" casing from 4500. Run tubing to 4550, spot 50 sack cement plug. Tag top of plug at 4324. Perf 8 5/8" casing at 450'. Pump 200 sacks cement, cement circulated to surface. Spot 30' cement plug at surface & install dry hole marker. Well P&A 6/4/88.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Wesley H. Hallett TITLE Agent DATE 11-14-88  
APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE APR 7 1989  
CONDITIONS OF APPROVAL, IF ANY:

8