

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
Z-854

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" FORM C-101 FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator BTA OIL PRODUCERS	8. Farm or Lease Name Baum 704 JV-D "Com"
3. Address of Operator 104 South Pecos Midland, Texas 79701	9. Well No. 1
4. Location of Well UNIT LETTER A 660 FEET FROM THE North LINE AND 510 FEET FROM THE East LINE, SECTION 2 TOWNSHIP 14-S RANGE 32-E N.M.P.M.	10. Field and Pool, or Wildcat Baum Upper Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4293' GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify OCD Hobbs (505) 393-6161 - 24 hrs before plugging operations commence.
2. Set 75 sx cmt plug @ 8336' (5-1/2" csg stub).
3. Set 40 sx cmt plug @ 7600' (Top Abo).
4. Set 40 sx cmt plug @ 5490' (Top Glorietta)
5. Set 50 sx cmt plug @ 4020' (8-5/8" shoe)
6. Cut & Pull 8-5/8" Csg.
7. Set 75 sx cmt plug @ 8-5/8" csg stub.
8. If salt is not behind pipe, set 75 sx plug @ Top & 75 sx @ base.
9. Set 75 sx cmt plug @ 389' (12-3/4" csg shoe).
10. Set 10 sx cmt plug @ Surface.
11. Install Dry Hole Marker.

Note: 9.5#/gal. mud between all plugs.

***A plug above the producing zone is required. It can either be a CIBP w/35' of cement, or a 100' cement plug.

Verbal Approval by Mr. John Runyon 12/21/78

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.			
SIGNED	BOB K. NEWLAND	TITLE	Regulatory Supervisor
DATE	12/29/78		
Jerry Sexton Dist 1, Sup		JAN 1 1979	
APPROVED BY		TITLE	