

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.
30-025-23839

5. Indicate Type of Lease
STATE FEE

6. State Oil & Gas Lease No.
N/A

7. Lease Name or Unit Agreement Name
West Tres Papalotes Pen Unit

8. Well No.
291

9. Pool name or Wildcat
Tres Papalotes Penn West

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL GAS WELL OTHER Unitized by R-9072

2. Name of Operator
Permian Resources, Inc. dba Permian Partners, Inc.

3. Address of Operator
P.O. Box 590; Midland, TX 79702

4. Well Location
Unit Letter L : 1980 Feet From The South Line and 660 Feet From The West Line

Section 29 Township 14-S Range 34-E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4141 GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: _____ <input type="checkbox"/>		OTHER: _____ <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

02-03-98 - Notified OCD. MIRU. Pumped 25 sx C cmt @ 10,444'. RIH w/ tbg, no tag. Pumped 25 sx C cmt @ 10,125'.
02-04-98 - Tagged plug @ 10,434'. Pumped 25 sx C cmt @ 10,434'. WOC and tagged plug @ 10,307'. Circulated hole w/ mud and pumped 25 sx C cmt 7,026-6,646'. Pumped 25 sx C cmt 4,471-4,091'.
02-05-98 - Contacted Elizabeth w/ OCD. Stretched 4-1/2" csg; freepoint @ 3836'. RIH and cut csg @ 3792'; csg free. POOH w/ 4-1/2" csg.
Not w/ocd
02-06-98 - Notified Debbie w/ OCD. Loaded hole w/ mud and pumped 40 sx C cmt @ 3,832'; WOC and tagged plug 3,656'. Cut 8-5/8" csg @ 408' and POOH w/ 8-5/8" csg. Loaded hole and pumped 40 sx C cmt 2,012-1,858'. Pumped 110 sx C cmt @ 487'.
Not w/ocd
02-09-98 - RIH and tagged plug @ 247'. Pumped 20 sx C cmt 30'-surface. RDMO.
02-27-98 - Cut off wellhead and capped well. Cleaned location and installed dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Randy Bruno TITLE Production Manager DATE 2-28-98

TYPE OR PRINT NAME Randy Bruno TELEPHONE NO. 915-685-0113

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

IC CW

de
da