

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-7

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Texaco Producing Inc.	8. Farm or Lease Name E. L. Richardson
3. Address of Operator PO Box 728, Hobbs, New Mexico 88240	9. Well No. 1
4. Location of Well UNIT LETTER 0 1980 FEET FROM THE East LINE AND 660 FEET FROM THE South LINE, SECTION 33 TOWNSHIP 13S RANGE 36E NMPM.	10. Field and Pool, or Wildcat McDonald Upper Penn
15. Elevation (Show whether DF, RT, GR, etc.) 3964' DF	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☒

OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) MIRU 1/19/88. Pull rods and pump. Install BOP. Pull tubing.
- 2) Set CIBP at 10250'. Cap with 50' cement.
- 3) Cut 5 1/2" casing at 5033'. Pull 5 1/2" casing. Circulate hole with salt mud.
- 4) Spot 20 sxs. cement plug at 6500'. Spot 40 sxs. plug at top of 5 1/2" stub at 5033'. Tag. Spot 40 sxs. plug at 4605'. Tag. Spot 40 sxs. plugs at 3612' and 2500'.
- 5) Cut 8 5/8" casing at 776'. Pull 8 5/8" casing.
- 6) Spot 100 sxs. plug at 776'. Tag top of plug at 600'. Spot 100 sxs. plug at 433'. Tag top of plug at 367'. Spot 10 sxs. plug at surface. Cut off wellhead and install dry hole marker.
- 7) Well P & A effective 1/27/88.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

397-3571

SIGNED Ja Head TITLE Hobbs Area Superintendent DATE 2/24/88

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE 1988

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
FEB 20 1991
LIBRARY