

COPIES RECEIVED		
TRIBUTION		
FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
NM 212	
7. Unit Agreement Name	
8. Farm or Lease Name	
Viking State	
9. Well No.	
1	
10. Field and Pool, or Wildcat	
North Bagley Penn.	
12. County	
Lea	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator	
D A & S Oil Well Servicing, Incorporated	
3. Address of Operator	
P. O. Box 657 Hobbs, New Mexico 88240	
4. Location of Well	
UNIT LETTER A 660 FEET FROM THE North LINE AND 660 FEET FROM THE East LINE, SECTION 16 TOWNSHIP 12 S RANGE 33 E NMPM.	
15. Elevation (Show whether DF, RT, GR, etc.)	
4278 DF	

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>
SUBSEQUENT REPORT OF:	
REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Run and set 5½" CIBP @ 8700'. Capped w/ 4 sx. cmt.
2. Perforated 5½" @ 5948. Broke circ. and displaced w/MLF.
3. Cut 5½" @ 5950'. POH and Laid down 5½" casing.
4. Ran 2-7/8" tbg. to 5950' and spotted 40 sx. cmt. plug.
5. POH w/2-7/8" to 3948' and spotted 40 sx. cmt. plug.
6. Cut 8-5/8" csg. @ 1228' and laid down.
7. Ran 2-7/8" tbg. to 1278 and spotted 75 sx. cmt. plug.
8. POH w/2-7/8" to 396' and spotted 75 sx cmt. plug.
9. POH w/2-7/8" and spotted 10 sx. cmt. plug in top of 13-~~2~~8 csg.
10. Cut off well head and installed dry hole marker.

Work completed 5-24-74

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Paul J. Blum</u>	TITLE <u>Vice President</u>	DATE <u>7-17-74</u>
APPROVED BY <u>Nathan E. Cleary</u>	TITLE <u>Chief</u>	DATE <u>7-17-74</u>
CONDITIONS OF APPROVAL, IF ANY:		