

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-24228
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER SWD Well	7. Lease Name or Unit Agreement Name Lowe SWD
2. Name of Operator Samedan Oil Corporation	8. Well No. # 1-H (SWD 302)
3. Address of Operator 10 Desta Drive, Suite 240 East, Midland, Texas 79705	9. Pool name or Wildcat None
4. Well Location Unit Letter <u>H</u> : <u>1986</u> Feet From The <u>North</u> Line and <u>660</u> Feet From The <u>East</u> Line Section <u>3</u> Township <u>13-S</u> Range <u>37-E</u> NMPM <u>Lea</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3902 KB	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Approximate Date of operations = 6/1/92

Cement type = Class "C" Neat

Mud = 9.5 PPG Salt Jel

1. Set 100' plug on bottom @ 12,360'. 20 sx.
2. Set Stub plug @ 3 1/2" liner plug (12,144) 50' in and 50' out. 20 sx.
3. Set 100' plug at Penn top (9605'). 20 sx.
4. Set 100' plug @ 5700' (Glorieta top). 20 sx.
5. Intermediate csg set @ 4530'. Will attempt to shoot and pull 5 1/2" csg at this point.
6. Set Stub plug @ 5 1/2" csg plug, 50' in and 50' out. 25 sx.
7. Set 100' plug at top of salt @ 2290'. 30 sx.
8. Set surface plug w/10 sx.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Judy Throneberry TITLE Division Production Clerk DATE 5/4/92
TYPE OR PRINT NAME Judy Throneberry TELEPHONE NO. 915-684-8491

(This space for State Use)

Orig. Signed by
Paul Kautz
Geologist

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.